

AIWA CO., LTD UTSUNOMIYA FACTORY

2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-2116, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, DEC. 20, 1998

REF. NO.: SI-98-037

CUSTOMER RELATIONS & SERVICE DIV.

MODEL

: AM-F5 D, AEZ, AHE / F7 D, AH

SUBJECT

: Interference from FM radio wave on signals recorded using a microphone.

CONTENTS:

In strong electric field of FM radio wave, interference from the radio wave may occur in


signals recorded using a microphone. Take the following actions against the

symptom.

Add two input-control resistors 470- Ω and two 1000-pF capacitors.

Connect the resistors to the lands of C732 and C734, in series to C732 and C734. Apply the capacitors between pin2 - pin 4, and between pin3 - pin4 of L 730. Add an

extension wire between pin2 - pin4.

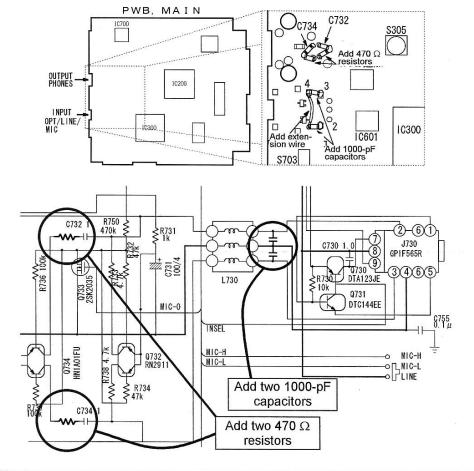

Ref.	Part name	Part number	Remarks
	C-RES U 470 C-CAP U 1000p	88-108-471-080 87-012-274-010	2-unit package 2-unit package

^{*} The parts listed above cannot be substituted by any other part.