


SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, DEC. 20, 1998
 REF. NO.: SI-98-037
 CUSTOMER RELATIONS & SERVICE DIV.

- MODEL : AM-F5 D, AEZ, AHE / F7 D, AH
 SUBJECT : Interference from FM radio wave on signals recorded using a microphone.
 CONTENTS : In strong electric field of FM radio wave, interference from the radio wave may occur in signals recorded using a microphone. Take the following actions against the symptom.
 Add two input-control resistors 470-Ω and two 1000-pF capacitors.
 Connect the resistors to the lands of C732 and C734, in series to C732 and C734.
 Apply the capacitors between pin2 - pin 4, and between pin3 - pin4 of L 730. Add an extension wire between pin2 - pin4.

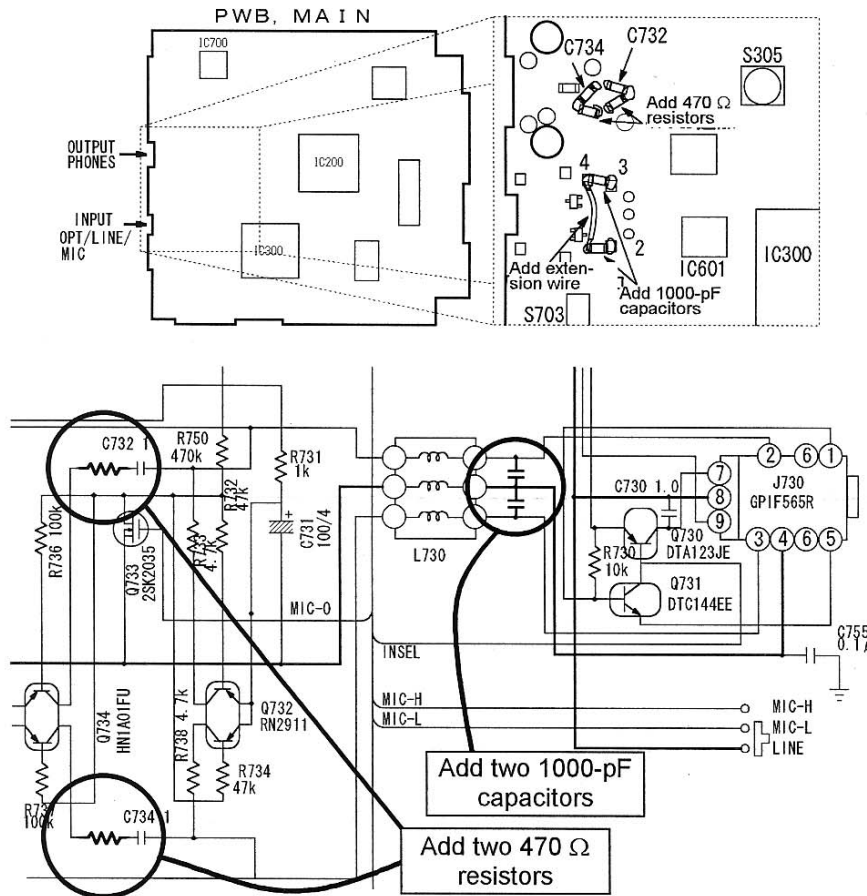

Ref.	Part name	Part number	Remarks
	C-RES U 470	88-108-471-080	2-unit package
	C-CAP U 1000p	87-012-274-010	2-unit package

* The parts listed above cannot be substituted by any other part.