



AIWA CO., LTD
UTSUNOMIYA FACTORY
2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, JULY 30, 1997
REF. NO.: S1-97-024
CUSTOMER RELATIONS & SERVICE DIV.

MODELS: NSX-E5M / CA-DW570M
SUBJECT: CD programming PLAY malfunction

SYMPTOM: For the above models, there are cases in which the programmed song is not played, or a song that was not programmed is played.
When such symptoms are indicated by the user, perform the remedy described below.

REMEDY: Replace the microcomputer listed below.

Testing Method

- 1) Insert a disc into DISC 1.
- 2) Program songs 10 and 12, and then PLAY.
- 3) If song 11 is played after song 10, replace the microcomputer.
- 4) The set is operating correctly if the songs are played as programmed.

Ref. No.	Part Name	Part No.
IC501	IC, LC86P7148-5JAK	SV-T00-044-010