

aiwa

AIWA CO.,LTD.

UTSUNOMIYA FACTORY

2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, JULY 15, 1996

REF. NO. : SI-96-018

CUSTOMER RELATIONS & SERVICE DIV.

MODEL : NSX-V800. CX-NK80. NAV80

SUBJECT : CD dropout, speaker box moves

CONTENTS : While playing the CD with T-BASS ON, BBE ON, GEQ ON (Rock or Disco), and with the volume beyond the 10 o'clock position, errors such as CD dropout or movement of the SP BOX occur.

REMEDY : Replace the following parts.

1. NSX-V800, CX-NK80

Ref.		Parts No.	REMARK
R751, 752	C-RES, 100Ω-1/10W → C-RES, 6.8KΩ-1/10W	88-118-682-080	Fig-1
C221, 222	CAP, 1μ/50V → CAP, 0.1μ/50V	87-016-247-080	Fig-2
C229, 230	CAP, 10μ/50V → CAP, 2.2μ/50V	87-010-495-010	Fig-2

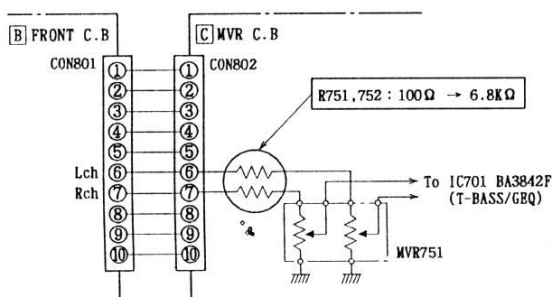


Fig. 1

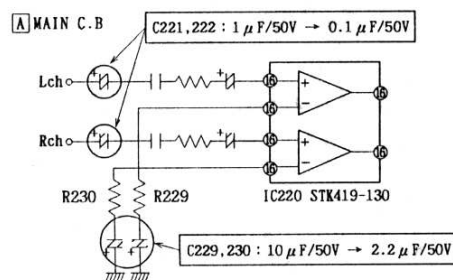


Fig. 2

2. CX-NAV80

Ref.		Parts No.	REMARK
R751, 752	C-RES, 1KΩ-1/10W → C-RES, 15KΩ-1/10W	88-190-153-010	Fig-3
C221, 222	CAP, 1μ/50V → CAP, 0.22μ/50V	87-010-545-010	Fig-4
C229, 230	CAP, 10μ/50V → CAP, 2.2μ/50V	87-010-495-010	Fig-4

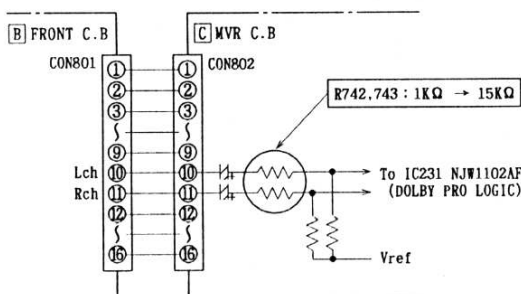


Fig-3

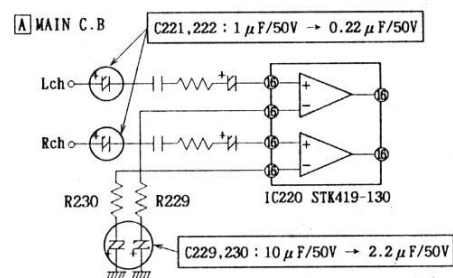


Fig-4