

# aiwa

AIWA CO.,LTD

UTSUNOMIYA FACTORY

2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

## SERVICE TECHNICAL INFORMATION




### ONE POINT REPAIR

UTSUNOMIYA, JUNE 15, 1994

REF. NO. : SI-94-007

SERVICE ENGINEERING DIV.

- MODEL : NSX-320 HE. LH. E. K. Z. U.  
CX-N3100 U.
- SUBJECT : While in the CD function mode, there is a noise when turning off the power.
- SYMPTOM : There are cases in which a clicking sound may occur when turning off the power after playing a CD for several minutes.
- REMEDY : Insert a resistor (330Ω 1/2W) between the Q109 collector and the ground, and then, attach it on the board with DiaBond #1620 (black). DiaBond #1620 (black) is available at Service Parts Center Japan.  
This procedure enables the unit to mute sounds promptly after the power is turned off, and as a result, no clicking sounds occur.

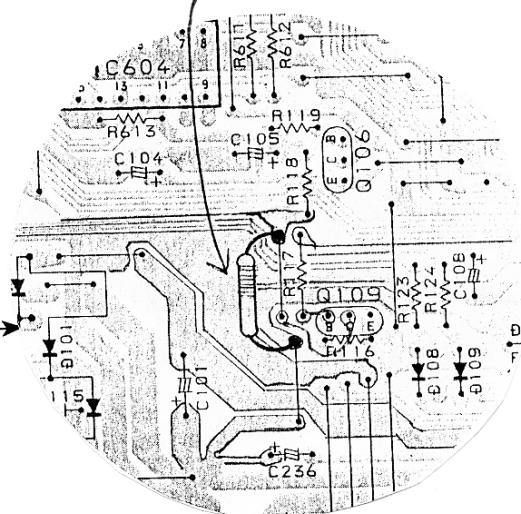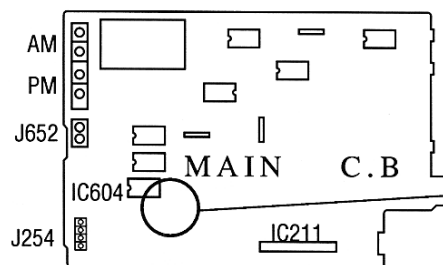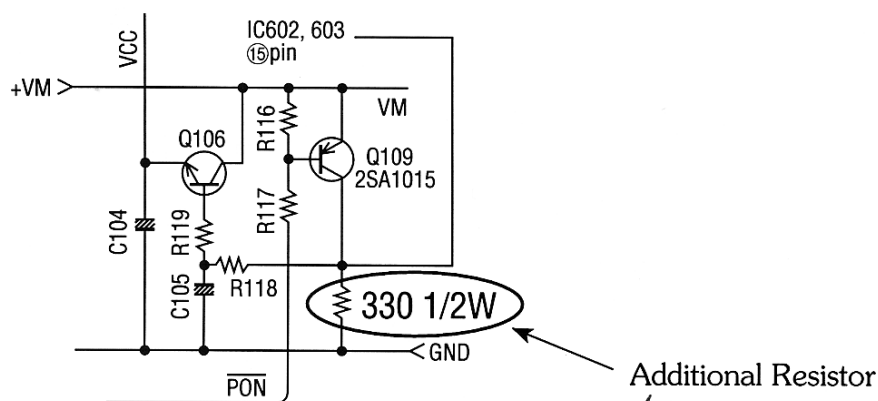

Ref.	Part Name	Part Number
	RES, 330-1/2W	88-141-331-010