

aiwa

AIWA CO.,LTD
UTSUNOMIYA FACTORY


2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, JUNE 15, 1996
REF. NO. : SI-96-012
CUSTOMER RELATIONS & SERVICE DIV.

- MODEL : HS-JS145 / JS147
SUBJECT : Recorded sound is faint or muffled
CONTENTS : Slippage of the erasing head causes recorded sound to be faint or muffled.
- REMEDY :
1. With no cassette in the unit, press the record button while holding the REC prevention lever with your finger.
 2. From the outside of the unit, loosen the mounting screw and remove the EH assy from LEVER REC.
 3. Paste an EH spacer (86-HJ9-610-010) under the EH assy (LEVER REC side).
 4. Attach LEVER REC to the EH assy and attach the screws with glue.

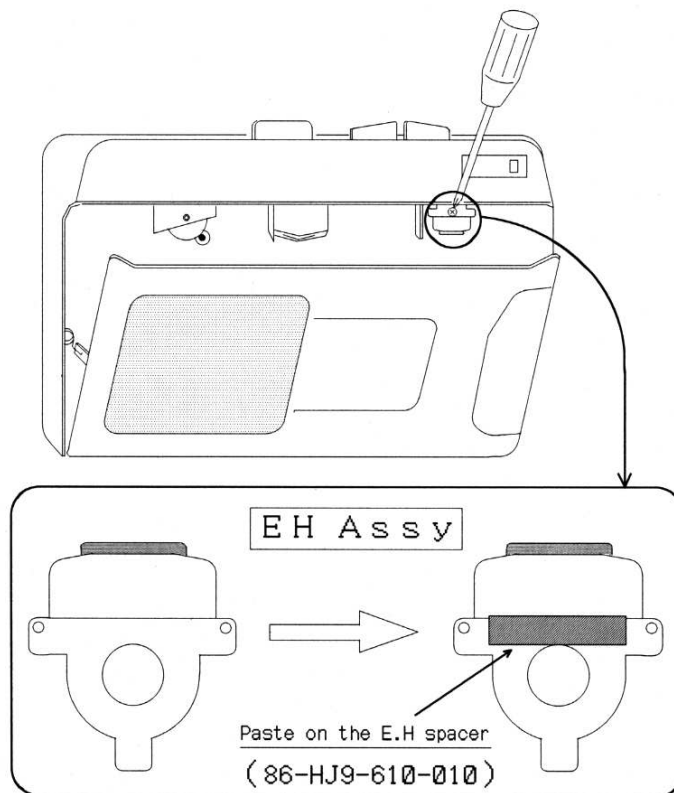

Note:

- Confirm that record / play sensitivity has been improved by using a test tape (TTA-601) to record and play a 1 KHZ-60 dB signal (Input: MIC terminal, Output: HP terminal) before and after performing the remedy.

Part No.	Part Name	Ref. No.
86-HJ9-610-010	EH Spacer	—