

aiwa

AIWA CO., LTD
UTSUNOMIYA FACTORY
2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, JULY 31, 1997
REF. NO.: S1-97-026
CUSTOMER RELATIONS & SERVICE DIV.


MODEL : HS-JS445

SUBJECT : Noise occurred during radio recording

CONTENTS : When sound recording on radio mode is made with the above model, "peep" sound (REC BEAT) may be recorded. If such a symptom is indicated, perform the remedy below.


REMEDIES : ① For noise during FM reception

As shown in the figure below, solder the wire to the body of X'TAL (X301) of the CONTROL CB and connect the body to GND of C327.

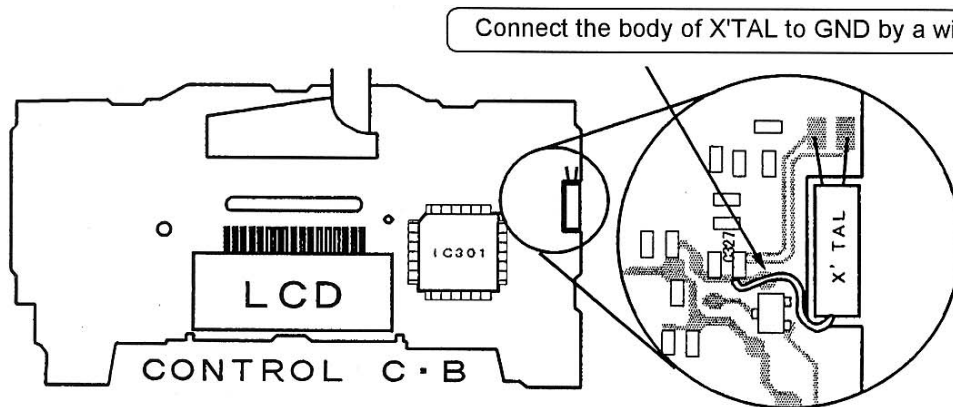

② For noise during AM reception

As shown in the figure below, attach a shield sheet (20 x 30 mm) to the cassette holder side of the CONTROL CB.

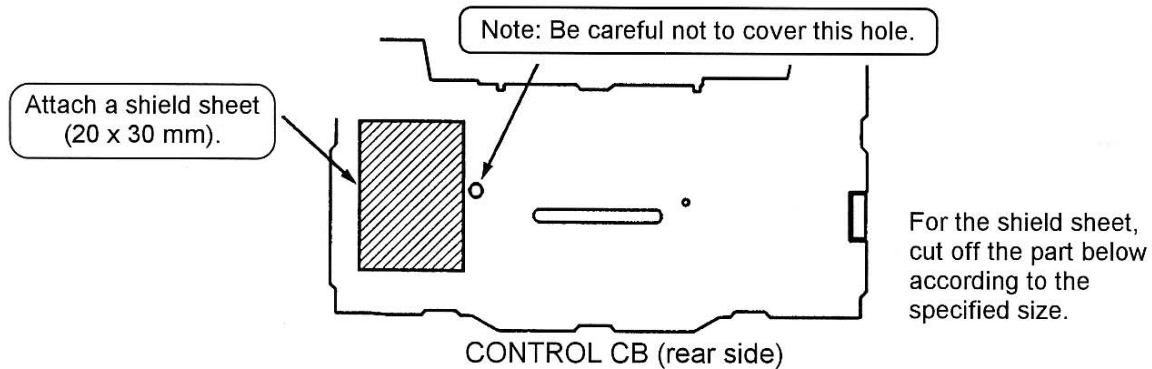

Ref.	Part Name	Part No.
	SH, DS EMI-3	84-XK2-241-010