

AIWA CO.,LTD UTSUNOMIYA FACTORY

2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, November 30, 1994

REF. NO.: SI-94-033 CUSTOMER SERVICE H.Q.

MODEL

HS-JX649/JX749

SUBJECT SYMPTOM Noise caused by a shock when AM is on.

When AM is on, a crackling noise occurs if the cabinet on the operation panel side (under the

STOP key) is pressed. This tends to occur more often when receiving high frequency in a weak


electric field.

REMEDY

If the customer complains about this, replace the IF filter for AM (C-FILTER, 450K) with the

following item. This will reduce the noise.

Part Number: 87-008-540-080 Part Name: C-FILTER, 450K

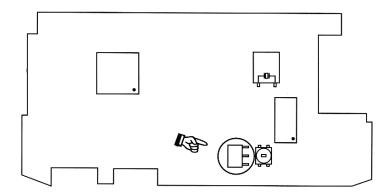

Note: 1) Units which were manufactured from the 19,000th unit (production from the middle of October) do not need this repair, because the above item is used.

- 2) The outer side of the new IF filter (87-008-540-080) is molded.
- 3) Due to a slight difference in parts of the new IF filter, soldering is not necessary.

Ref.	Part Name	Part Number
CF303	C-FILTER, 450K (ECFM2)	87-008-540-080