

aiwa

AIWA CO., LTD
UTSUNOMIYA FACTORY
2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-2116, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR


UTSUNOMIYA, SEP. 20, 1998
REF. NO.: SI-98-026
CUSTOMER RELATIONS & SERVICE DIV.

MODEL : HS-JX808/807/804

SUBJECT : Noise is produced when DSL is on.

CONTENTS : With the DSL turned on, low frequency noise may be heard when the sound level is small or when there is no sound. If such a low frequency noise is pointed out by the customer, perform the following remedy:

REMEDY : Place a chip resistor (15 kilohms) on top of the chip capacitor C427 (0.15 microfarad), and bond them by soldering.

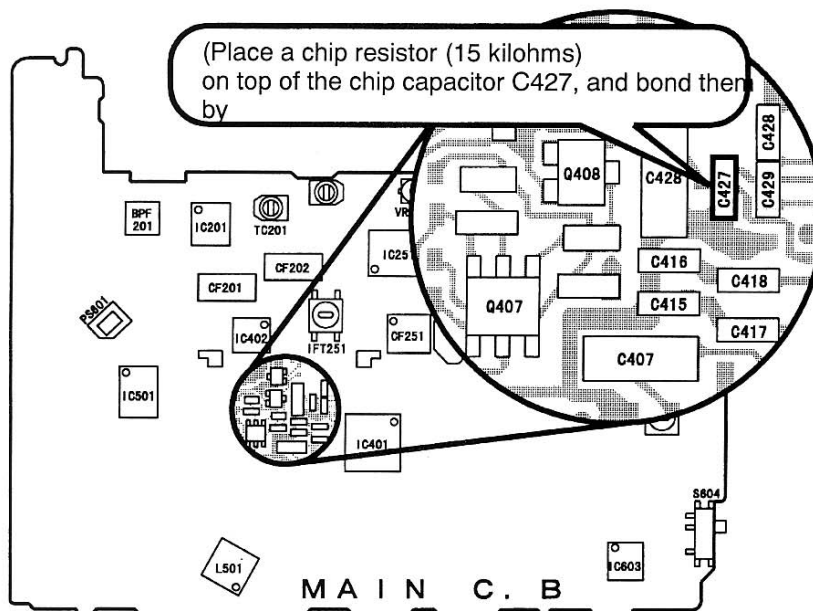

The products Serial No.S **** 8810001 and thereafter are provided with the above remedy taken at the time of production.

Above remedy are incorporated into the main circuit boards having the following parts numbers and thereafter:

HS-JX808.....88-HJ3-602-110
HS-JX807, 804.....88-HJ3-613-210

Ref.	Parts name	Parts No.	Remarks
R456	C-RES, U 15K-1/16WJ	88-108-153-080	