

aiwa

AIWA CO.,LTD

UTSUNOMIYA FACTORY

2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

SERVICE TECHNICAL INFORMATION



ONE POINT REPAIR

UTSUNOMIYA, January 15, 1995

REF. NO. : SI-94-041

CUSTOMER SERVICE H.Q.

- MODEL : HS-JX838
SUBJECT : Noise occurs during TV recording
CONTENT : A noise caused by the photo sensor pulse signal occurs during TV recording. This noise can be detected by the REC monitor and a small amount of the noise is recorded. If this problem is indicated by the customer, follow the remedy below.
- REMEDY : Add a 0.1 μ F chip ceramic capacitor between the Q26 collector and earth.
(Solder between the FLEX. C.B. 20 pin and 21 pin as shown in the diagram.)

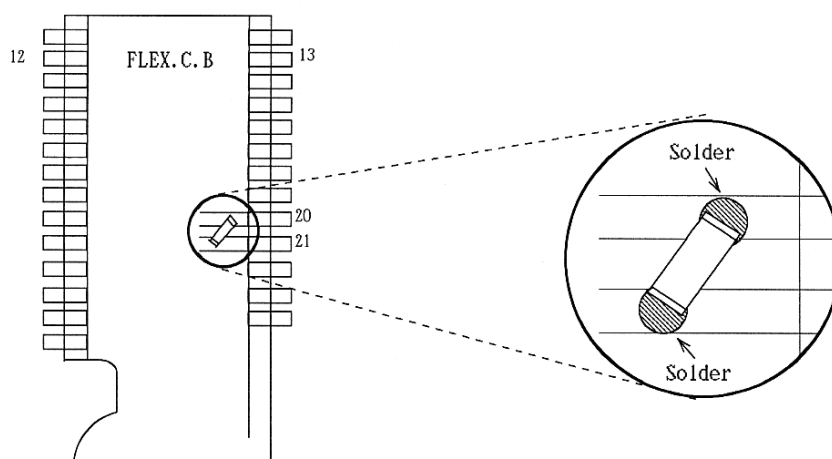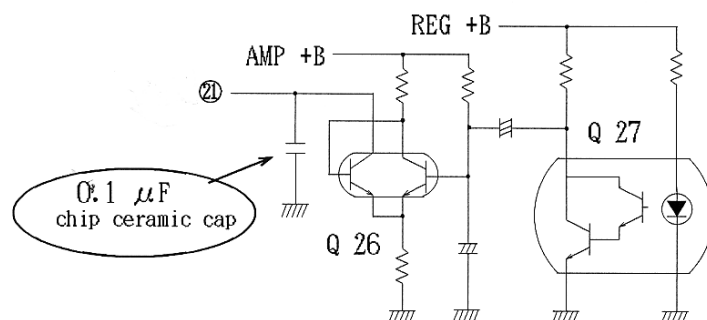

Ref.	Part Name	Part No.
C130	0.1 μ F ceramic capacitor	87-010-831-080