

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, JULY 31, 1997

REF. NO.: S1-97-025


CUSTOMER RELATIONS & SERVICE DIV.

MODEL : HS-JX819/-JX839/-JX859/-JX959

SUBJECT : Large noise during FM stereo reception

CONTENTS : In the above headphone stereos, "hoot" noise (oscillation sound at 500 Hz) may be heard from the headphones during FM stereo reception. In such a case, perform the remedy below.

REMEDY : Connect a tantalum capacitor of 10 μ F in parallel to the ceramic capacitor of 0.01 μ F which is connected to the power supply of the prescaler IC.

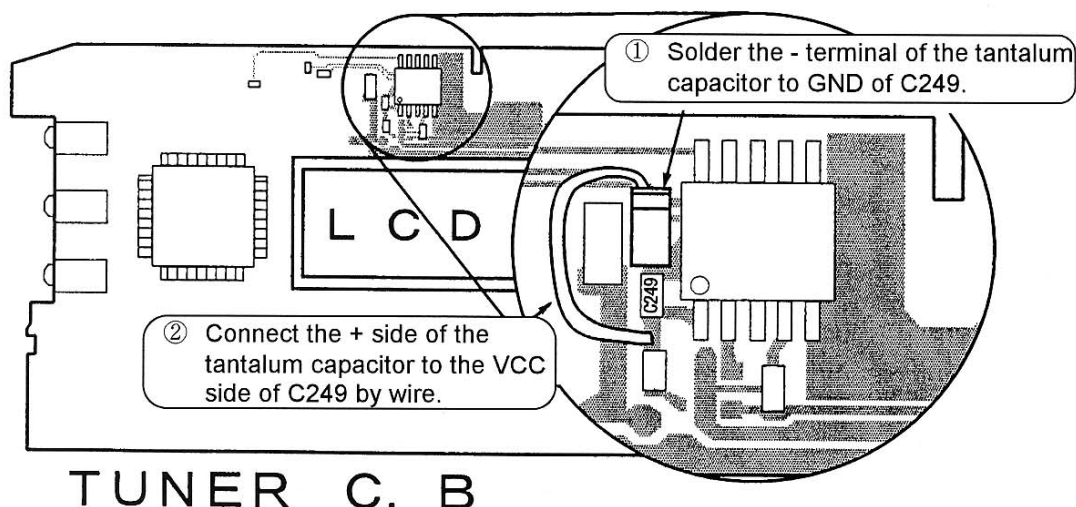

TUNER C. B

For the products of serial No. *****77A0001 and later, measures are taken by changing the resistor R246 of the power supply of the prescaler IC from 33 to 10 Ω in the production process.

Ref.	Part Name	Part No.
	C-CAP, TN 10-4	87-010-746-080