



AIWA CO.,LTD

UTSUNOMIYA FACTORY

2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, December 31, 1994

REF. NO. : SI-94-038

CUSTOMER SERVICE H.Q.

- MODELS : NSX-333 (HM) (HD)
NSX-320/360 (V) (VJ)
- SUBJECT : CD [AI Edit] defect
- SYMPTOM : For the above models, when recording onto a tape while using the AI Edit, one program (song) on the B side of the tape is recorded repeatedly. In such cases, take the following measures.
(Side A records normally)
- REMEDY : Replace the IC201 of the front board with the following parts.

		IC201		
①	NSX-333 Applies only to (HM) and (HD)	μ PD78043GF-050 83-NE2-695-110	→	μ PD78043GF-083 83-NE2-695-210
②	NSX-320/360 Applies only to (V) and (VJ)	μ PD78044GF-051 82-NE8-656-010	→	μ PD78044GF-090 82-NE8-656-110

* Models to be repaired: NSX-320/360 models manufactured after February, 1994
NSX-333 models manufactured after April, 1994