

aiwa

AIWA CO., LTD
UTSUNOMIYA FACTORY
2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, AUGUST 30, 1997
REF. NO.: SI-97-032
CUSTOMER RELATIONS & SERVICE DIV.

MODELS : NSX-999mk2

SUBJECT : Noise from speaker during VR adjustment

SYMPTOMS: With respect to the aforementioned model, when the VR is adjusted, noise such as commotion may be heard from the speaker. When it is indicated, take the following countermeasure.

Confirmation method : Turn the VR during the playback on the third song (17 Hz) of the test CD (TCD-782), the symptom can be confirmed comparatively easily.

REMEDIES : Eliminate the following resistors.

- 1) R813 and R814, 22 kilo ohm on the MVR C.B.

