

aiwa

AIWA CO., LTD
UTSUNOMIYA FACTORY

2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-2116, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, OCT. 30, 1998

REF. NO.: SI-98-031

CUSTOMER RELATIONS & SERVICE DIV.

MODEL : NSX-A303 and A304

SUBJECT : Addition or replacement of relay circuit


CONTENTS :

Relay circuit has been added to some of the products of the above models.


Before repairing, refer to the following identification method and circuit diagram, pattern diagram, and replacement parts list for details.

1. Identification method


Relay circuit has been added to the units with "A" mark (white "A" letter on red) labels put on rear panel.

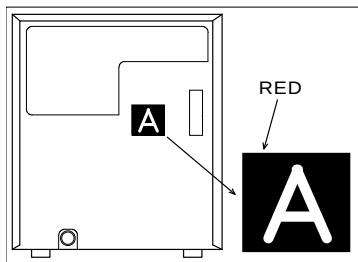

2. Pattern diagram

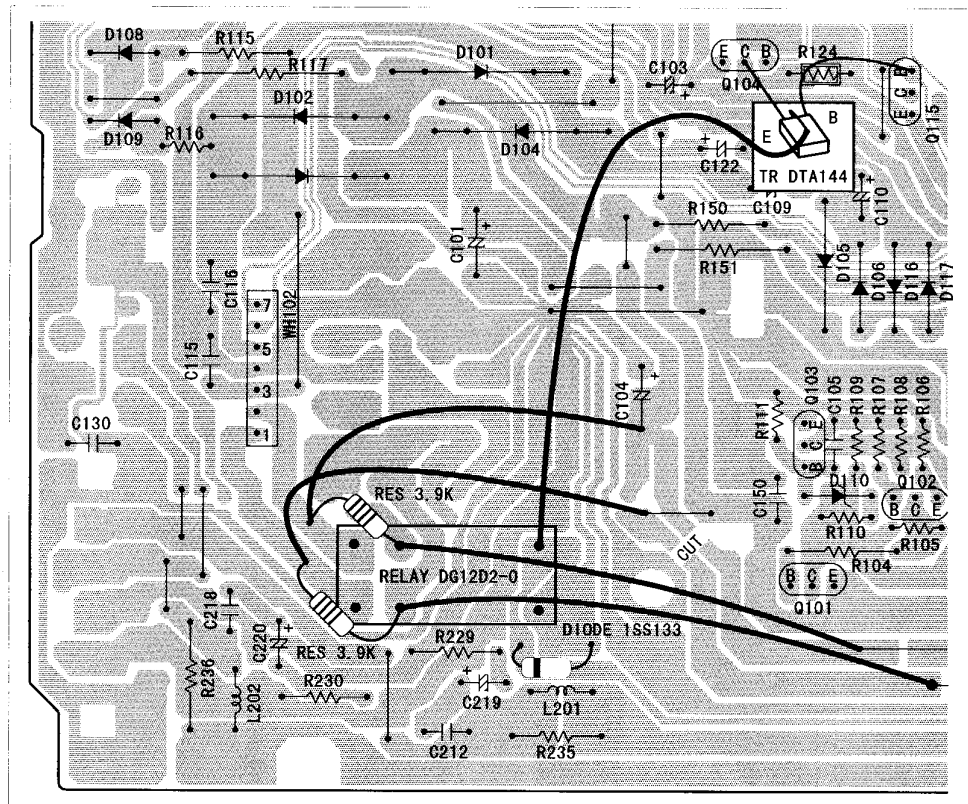

3. Circuit diagram

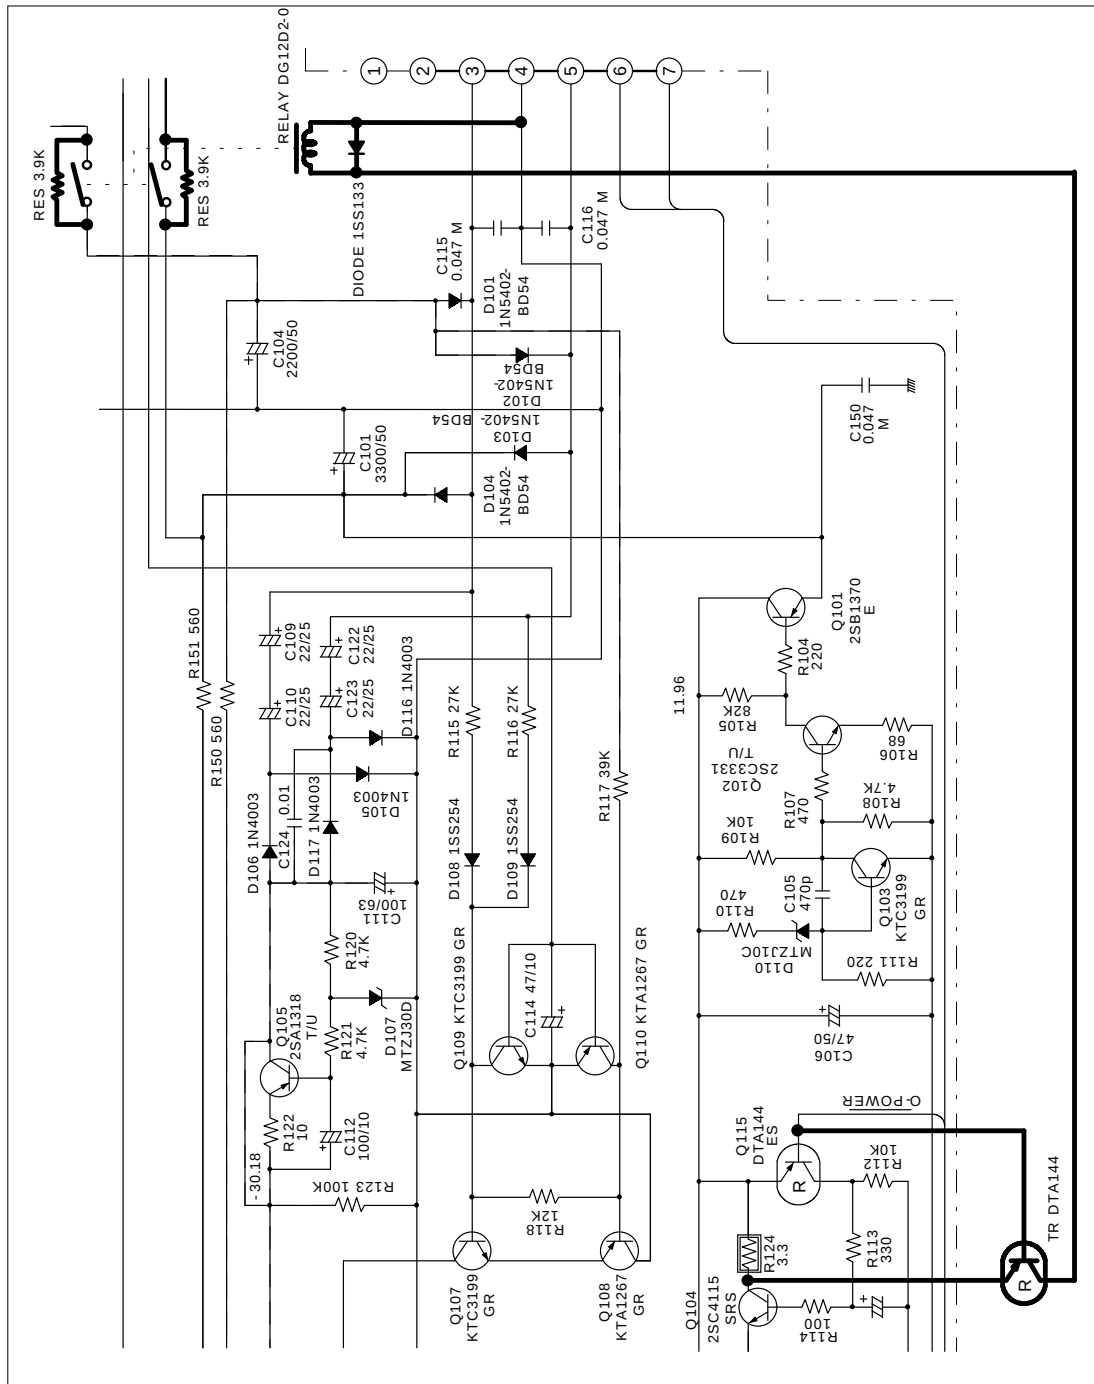

4. Parts list

No.	Part name	Part number	Quantity	Remarks
1	TR, DTA114 ES	87-026-269-080	1	
2	RELAY, DG12D2-0	87-A90-464-010	1	
3	DIODE 1SS133	87-020-465-080	1	
4	RES 3.9K-1/4J	88-130-392-080	2	