

## SERVICE TECHNICAL INFORMATION


UTSUNOMIYA, JUNE 15, 1997  
 REF. NO.: S1-97-014  
 CUSTOMER RELATIONS & SERVICE DIV.

### ONE POINT REPAIR

**MODELS:** NSX-V100  
**SUBJECT:** Strange noise emitted from the speaker when playing a CD  
**SYMPTOM:** For the above model, there are cases in which a strange sound can be heard from the speaker when playing a CD. When such a symptom is indicated by the customer, perform the remedy described below.

- REMEDY:** Following the steps below, attach the child board (PWB ASSY SUB2).
- 1) Remove the 2 resistors (R101, R102) and 4 condensers (C101, C102, C106, C111) from the child board CD C.B.
  - 2) Solder the 8 child board wires to CD C.B.
  - 3) Using double-sided tape, attach the child board to the CD chassis and secure it with glue.

**Note:** Care must be taken so that the electrolytic capacitor connected on the child board does not come into contact with the CD C.B. land.

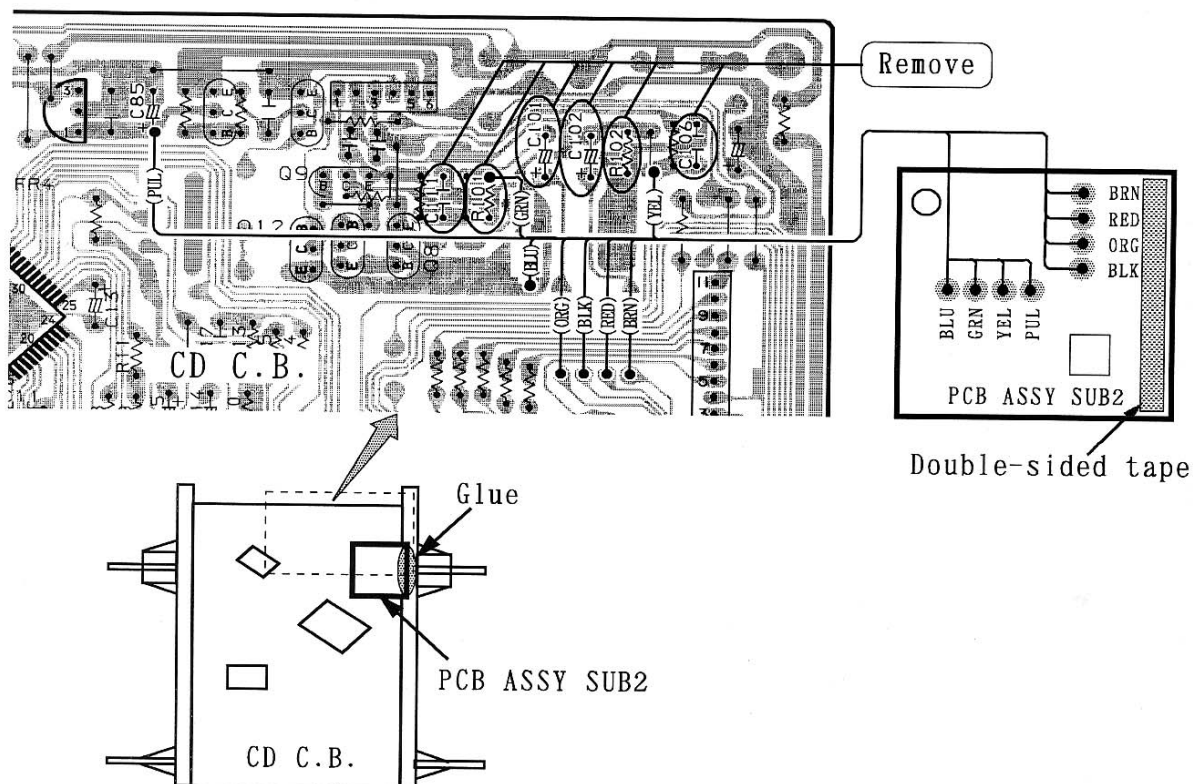

| Ref. No. | Part No.       | Part Name     |
|----------|----------------|---------------|
| —        | SV-T00-042-010 | PWB ASSY SUB2 |