


## SERVICE TECHNICAL INFORMATION

UTSUNOMIYA, AUGUST 31, 1997  
 REF. NO.: SI-97-029  
 CUSTOMER RELATIONS & SERVICE DIV.

### ONE POINT REPAIR

- MODEL : NSX-V200, E7M (E, K, Z)  
 SUBJECT : No CD operation  
 SYMPTOMS : With respect to the aforementioned model, the ICP may be disconnected due to mechanical restrictions of the CD and the CD may not operate. When it is indicated, take the following countermeasure.  
 REMEDIES : Change ICP-N10 on the CD C.B. to ICP-N15.

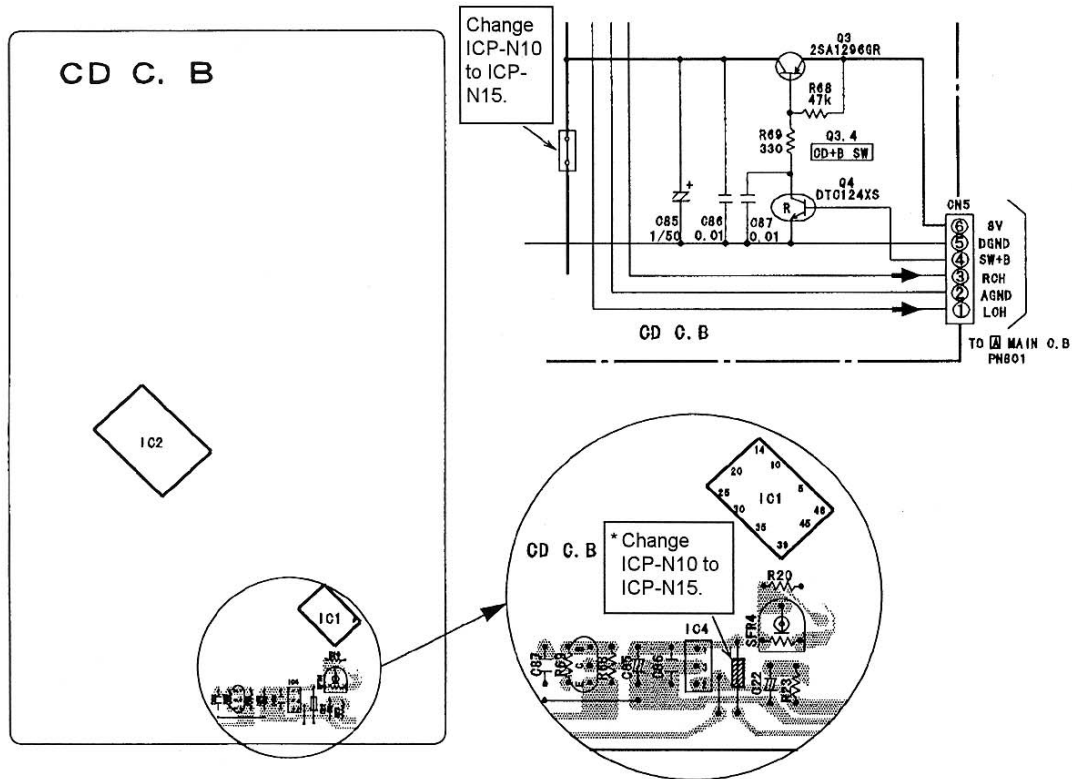

\* ICP-N10 is not described in the service manual. Instead it is described as jumper wire in the service manual.

Ref.	Part Name	Part No.
	ICP-N15	87-001-486-010