


## SERVICE TECHNICAL INFORMATION

UTSUNOMIYA, AUGUST 30, 1997  
 REF. NO.: SI-97-028  
 CUSTOMER RELATIONS & SERVICE DIV.

### ONE POINT REPAIR

- MODEL : NSX-V210  
 SUBJECT : No T-BASS effect  
 SYMPTOMS: When it is indicated that even if T-BASS is turned ON, no T-BASS effect is produced, take the following countermeasure.  
 REMEDIES : Change the following capacitors as shown below.
- 1) C503 and C504, 0.082  $\mu$ F to 0.033  $\mu$ F
  - 2) C505 and C506, 0.22  $\mu$ F to 0.33  $\mu$ F

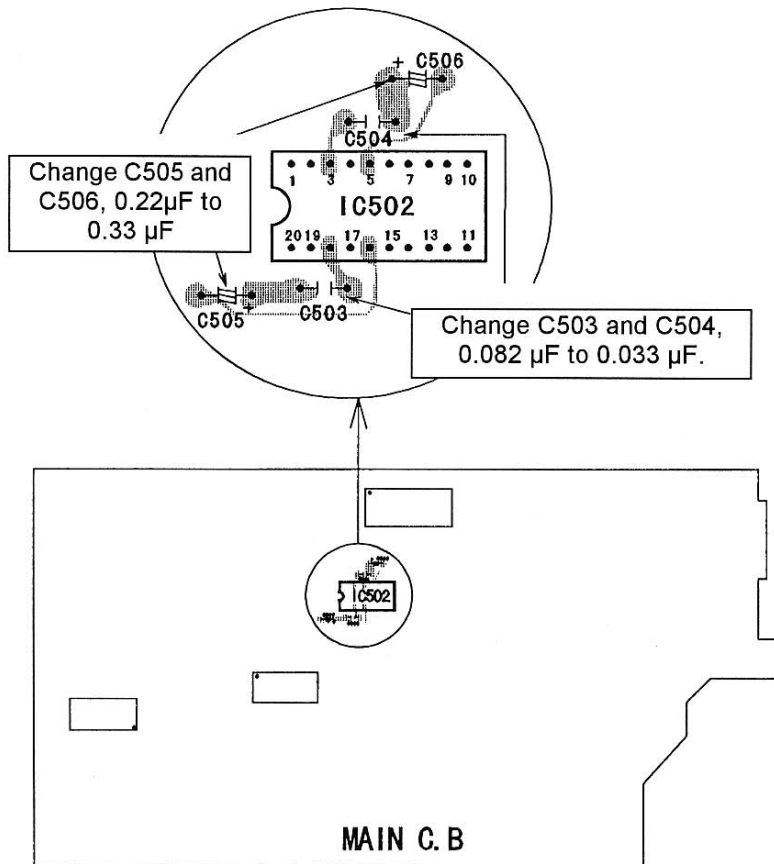

Ref.	Part Name	Part No.
C503, 504	CAP, 0.033-25	88-266-840-810
C505, 506	CAP, 0.33-50	88-707-789-010