

# aiwa

AIWA CO., LTD  
UTSUNOMIYA FACTORY  
2620, TOKUJIROU-MACHI, UTUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

## SERVICE TECHNICAL INFORMATION

### ONE POINT REPAIR


UTSUNOMIYA, JUN 17 1997

REF. NO. : SI-97-019  
CUSTOMER RELATION SERVICE DIV.

MODELS : Z-M2800/M2900/VM280/VM290, NSX-F9/V800/V900  
SUBJECT : No power/Sound Distortion due to power IC defect.  
CONTENTS : Due to power IC(STK-419-\*\*\*defect, it is caused to no power or sound distortion. It requires to modify following contents to all repair items when replace in the above mentioned power IC.

MEMO : This modification is required to do all in the above mentioned models for repair even power IC is not damaged.

REMEDY : To replace parts from chip jumper to chip resistor,  $100\Omega \cdot 1/8W$ , between pin① and ⑬ of IC220.

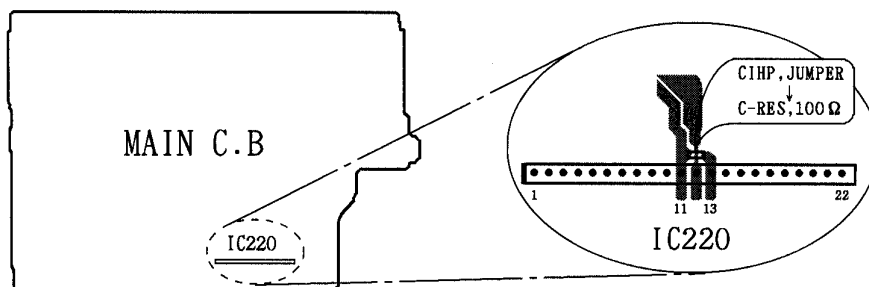

\* Applicable parts. : STK-419-130  
STK-419-140A  
STK-419-150

Ref.	PARTS CODE	PARTS NAME
	88-128-101-010	C-RES, 100Ω 1/8W