



# SAFETY BULLETIN



**Bulletin Part Number:** 267218-SB1

**Product:** Acoustimass® AM-6 series III, AM-10 series III, AM-15 series I,II and AM-16 Bass Modules.

**Subject:** Replace capacitor p/n 133623-473 in locations C872 and C873 on the Amplifier PCB.

**Disposition:** Replace C872 and C873 with capacitor p/n 286499-473. This modification is to be performed on all Acoustimass systems mentioned above prior to DOM = 5031.

Date Code example: DOM 5031 = 31<sup>st</sup> day of 2005 (January 31, 2005).

**Symptom:** None.

**Reason:** Improve safety and reliability.

**Solution:** Using the respective disassembly/assembly procedures in the AM-6 series III (267218), AM-10 series III (267217), \*AM-15 series I (198696), AM-15 series II (267216) and AM-16 (267216) service manuals remove the Amplifier PCB. Replace capacitors C872 and C873 with the new "Fail Open" capacitor, p/n 286499-473, refer to Figure 1 for the locations of the capacitor.

\*Note: Refer to Figure 2 for locating capacitors when repairing the AM-15 Series I.

Using a permanent black marker, mark the top-center of connector, J4, with a ~1/4in diameter black dot. This will indicate that the capacitors were changed.

Systems	Amplifier PCB	
	100Vac/120Vac	220Vac/230Vac
AM-6 Series III	266035-001	266035-002
AM-10 Series III	266664-001	266664-002
AM-15 Series I	199411-3 / 199411-1	199411-2
AM-15 Series II/ AM-16	266598-001	266598-002

Table 1: Amplifier PCB Part Numbers



# SAFETY BULLETIN

**BOSE**<sup>®</sup>  
Better sound through research<sup>®</sup>

Bulletin Part Number: 267218-SB1

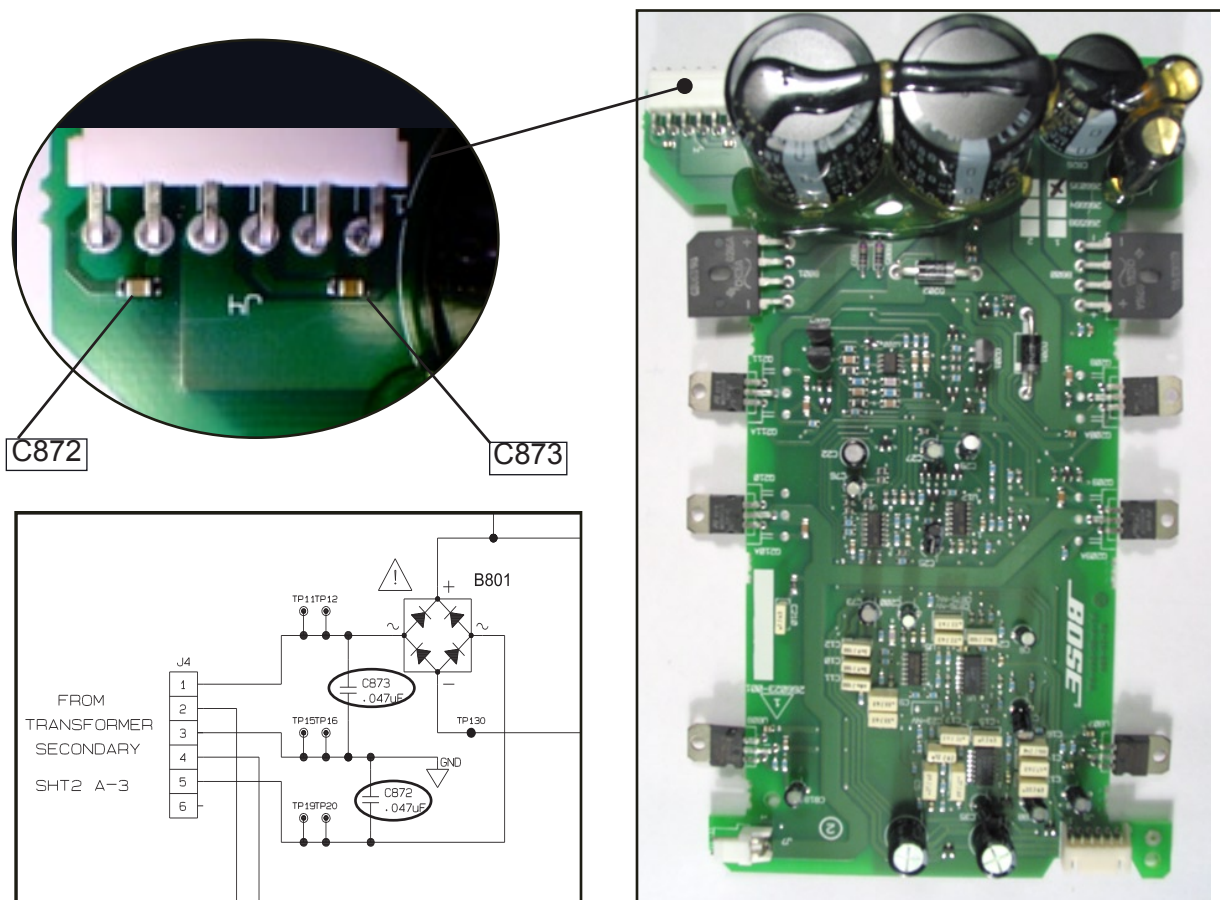


Figure 1: Amplifier PCB

ECN: 35713

Date Issued: 2/05



Page 2 of 3



# SAFETY BULLETIN

**BOSE**<sup>®</sup>  
Better sound through research<sup>®</sup>

Bulletin Part Number: 267218-SB1

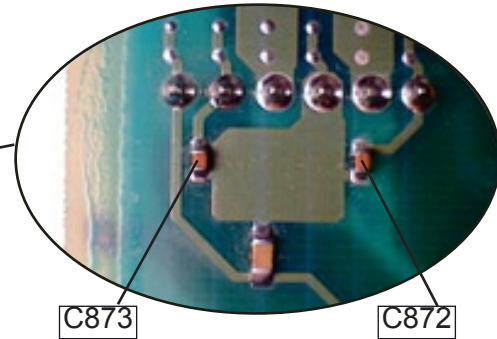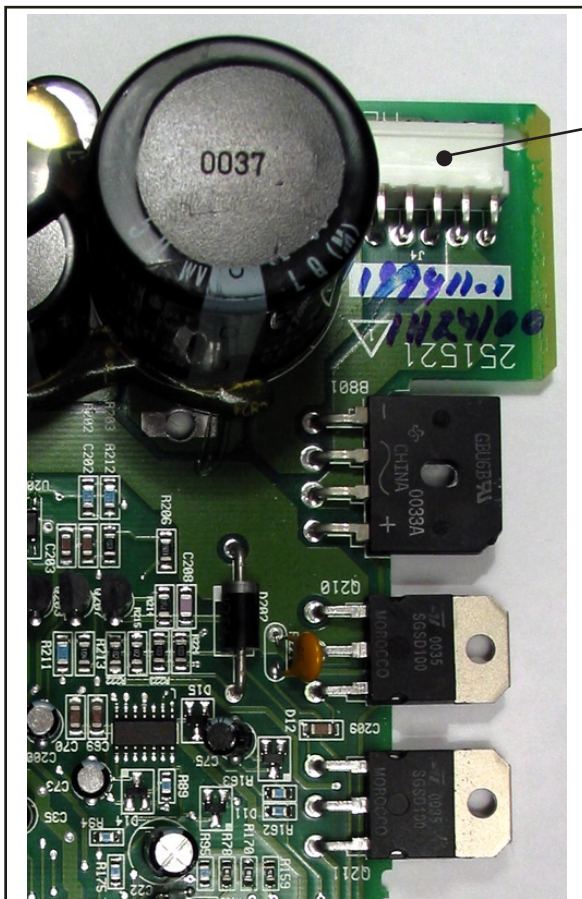

Solder Side of J4.

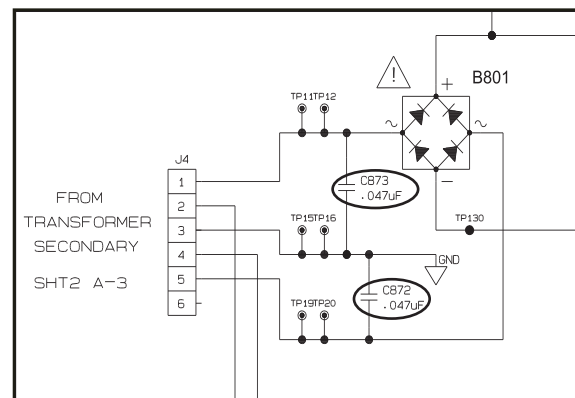


Figure 2: AM-15 Series I Amplifier PCB

ECN: 35713

Date Issued: 2/05

Page 3 of 3