



# SERVICE BULLETIN

**Bulletin Part Number:** 199401-B10

**Product:** AM25/30P II Digital Bass Modules

**Subject:** Failed opto coupler U300.

**Disposition:** Replace failed component U300.

As a preventative measure replace opto couplers with manufacturing part numbers of PS7141L-1A and PS7141-1A.

These opto couplers were used between 08/1999 and 01/2000.

U300 Bose part number 252450, NEC PS7141L-1A or PS7141-1A, may fail. Its typical failure is the top of this component will be missing, giving the appearance of a lightning strike.

Replace U300 with Bose part number 253843, NEC PS7341L-1A. Refer to your Powered Acoustimass 25/30P Series II Speaker System service manual part number 199401 for disassembly/assembly, test procedures, PCB layouts and schematic diagrams.

Bose Corporation  
The Mountain  
Framingham, MA 01701-9168

For Technical Assistance Call 1-800-233-4408

148940-rev01