

Technical Service Bulletin No. 27

Created by: Lab.gruppen AB Service Department

Date: 2011-10-11

Reference no: C12

It is highly recommended to implement this service bulletin as preventative maintenance if the unit is serviced for another issue.

Affected models

FP+.

C16:4, C28:4, C48:4, C68:4, C88:4.

PLM10000Q, PLM14000.

Affected boards/modules

SP100FXXx-FXX

SP130FXXx-FXX

SP140F01a-FXX, SP140F01b-FXX

Symptom


Screaming sound from power supply if amplifier powers up.

Amplifier does not power up.

Solution

Replace capacitor C12 with either of below listed components.

Lab Part No.	Description	Amount	Info	Pos
6n8250VMMK5	Wima: FKS2 6800PF 10% 400VDC	1		C12
6n8250VMMK5	Epcos: B32529-C3682-K289	1		C12

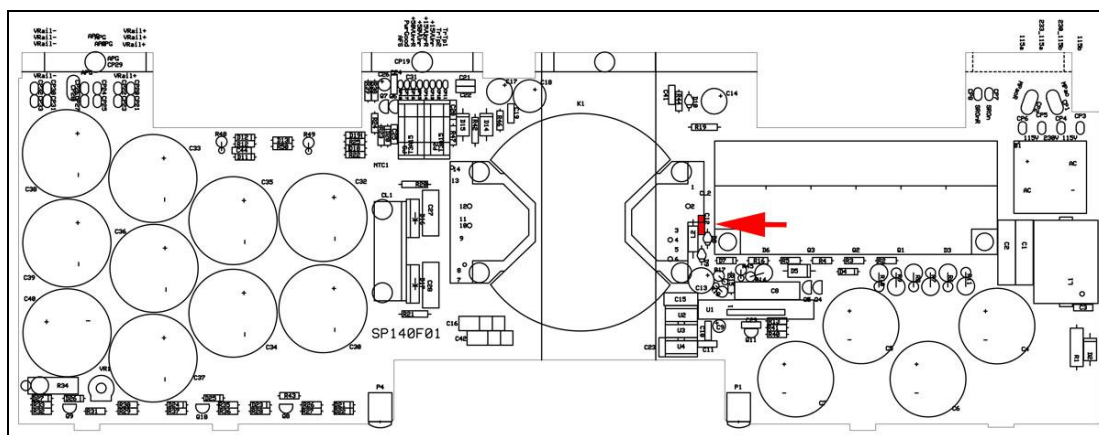

Service Log Information

Write “Technical Service Bulletin no.27” in column “Repair Remedy” besides other normal repair information.

History

Date	Created By	Status	Bulletin no.	Comment
2011-10-11	CL	SHARP	27	C12