



Service Bulletin

No.: MZ08-051


Date: September 25, 2008

Model: AV8003

Subject: Change of the XLR connector.


Symptom: Due to the XLR cable (male connector) varying in quality and also to wear, some XLR female jacks manufactured by Dongbo Industries Ltd. are not tight enough to lock when connectors are inserted.

Solution: The supplier of the POS NO. JK13/JK14 (CDR-X PWB) XLR female connector will be switched to Jyetai Precision Industrial Co., Ltd.

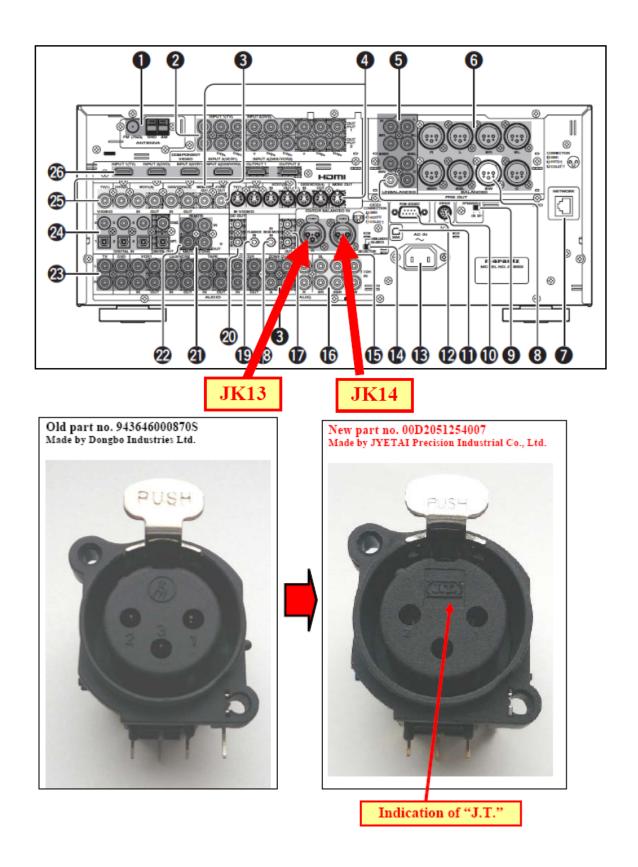

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

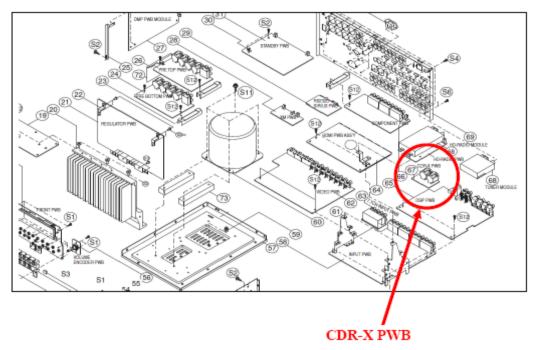

Parts:

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
JK13,	XLR JACK	943646000870S	XLR JACK	00D2051254007
JK14	Dongbo		JYETAI Ltd.	
	Industries Ltd.			

Serial Number Range:

Applies up to MZ04xxxxxxxxxx.

MZ05xxxxxxxxx and onwards have been corrected on production lines.