



**Service Bulletin** 

**No.:** MZ08-076 **Date:** March 17, 2009

\_\_\_\_\_

Model: AV8003

**Subject:** Software Update Information.

**Symptom:** 1. While the unit is connected to the MM8003 via the bus, MM8003 cannot be powered ON/OFF when the POWER ON/OFF button is being held down.

- 2. Pop noise is heard when Audyssey is run when the unit is being bi-amped.
- 3. When receiving the remote control command of
- <ZoneA,ZoneB,ZoneSpkA,ZoneSpkB> input from the front, the unit goes into ZONE input mode and becomes awkward to use. The operability is to be improved.

**Solution:** 1. The MAIN CPU (Mode 1) software must be updated. The updating must be done after the software (FDT) is downloaded. Please refer to Procedure Manual "<u>Update AV8003 MAIN CPU's software procedure by FDT</u>". (The procedure differs from that which is given in the Service Manual.)

2. The **DMP sub CPU** (Mode 6) software must be updated. For information about how to rewrite the firmware, open the Service Manual and refer to "**Mode 6: Update/Download DMP Sub CPU's software to internal Flash-ROM**".

First, please check the version of the current firmware in reference to **SERVICE MODE** of the Service Manual. After performing the update, check the indicated firmware version.

## **CONFIDENTIALITY NOTICE:**

## **Details of the modifications**

- 1) Because the front IR is not muted, output from the RC5 OUT is not accurate.
- 2) The surround back channel is not properly muted.
- 3) The unit is not programmed to display text during the preset scanning.
- 4) The unit is not designed for the ZONE remote to be used from the front.

## Parts:

Firmware Ver. – MAIN CPU: av8003\_rom\_0810301.mot

Part No: 00M46CW499A06

Firmware Ver. – DMP Sub CPU (Mode 6): DMP\_Sub\_08100602.mot

Part No: 00M46CW499F02

## **Serial Number:**

Applies to MZ05xxxxxxxxx (Service code 05) and earlier. This improvement has been done in the production from serial number MZ06xxxxxxxxx (Service code 06 and after).