


Model: AV8003

Subject: Improvement of audio noise

Symptom: The noise level of SBL, SBR, CENTER and SW channel increases when the DSP circuit is active (e.g. Dolby PLIIx, etc...).


Solution: Modify the POS.NO.58 INPUT PWB as follows:

1. Remove the J201, J202, J203 and J204.
2. Add the lead wire (part no.: 997614000110M) with a lug between J202 (outside solder pad of PWB) and chassis.
3. J201 is to be replaced with Ceramic Capacitor 0.1uF. (part no.: 00MDK96104300)

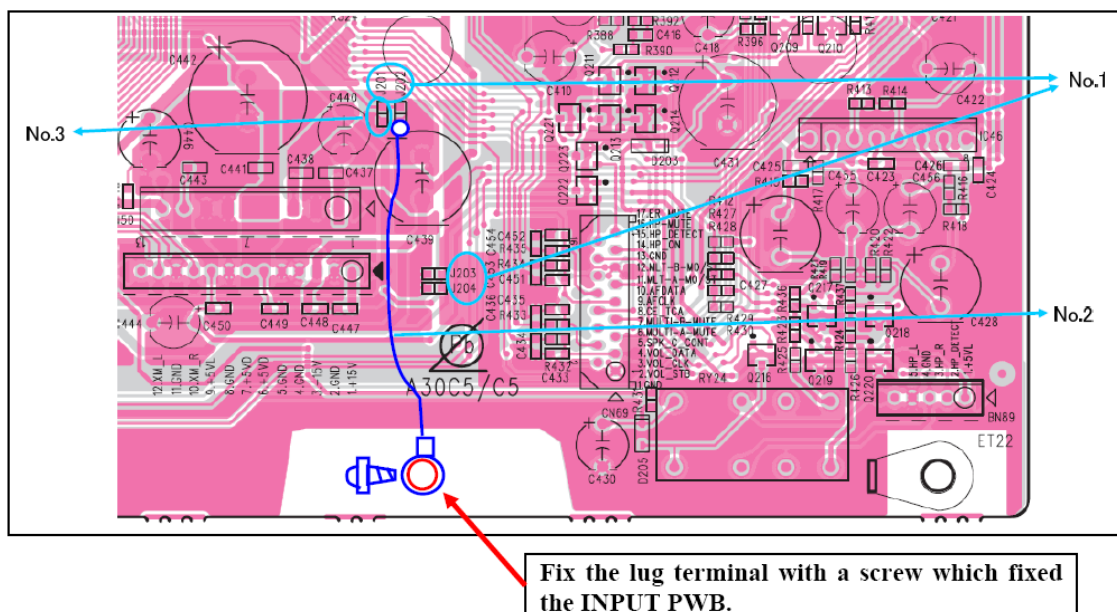

Parts:

Ref#	Description	Part Number
NA	Lead wire with lug	997614000110M
NA	0.1uf 50V Ceramic Capacitor	00MDK96104300

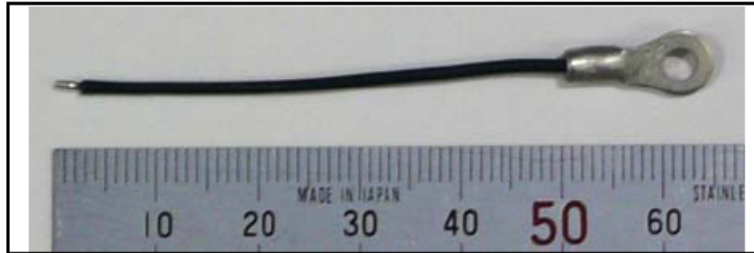

Serial Number Range:

This improvement has been done in production from serial number MZ07xxxxxxxx (Service code 07) and after.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.