



Service Bulletin

No.: MZ06-015

Date: December 19, 2006


Model: CC4300

Subject: The improvement of ALL Disc Repeat operation.

Symptom: When performing an ALL Disc Repeat operation if the set cannot read the disc's TOC, that Disc may spin at a high-speed rotation. In some instances the Disc may overflow from the Disc Tray.

Solution: Replace the CPU (POS.NO. IC101) u-PRO. "MASK: programmed" (VER-303) is changed to (VER-304). IC101 is located on the MAIN PWB.

Before updating the CPU, please check the Micro processor version. It can be confirmed from the "SERVICE MODE". Please refer to the CC4300 Service Manual on page 1 for the check procedure.

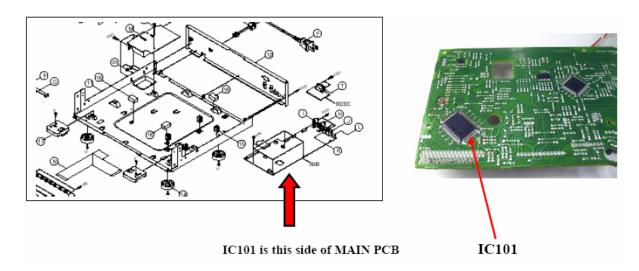

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Parts:

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
IC101	VER-302 or VER-303	90M- HU100740R	CXP825P400- 1 VER-304	90M- HU100780R
	VER 303	(*HU100710R)	1 VER 304	1101007001

Serial Number Range:

This problem applies to the following serial number range. CC4300/ U1B applies to MZ010613xxxxxx and earlier. This improvement has been done in production from serial number MZ010614xxxxxx and later.