

marantz®

Service Bulletin

No. : MZ00-002


Date: November 29, 2006

Model: CC870

Subject: FLD shows "JAMMED" and CD mechanism will not move to CD stored position.

Symptom: The CD position indication LED LENS touches the front panel.

Solution: Cut the small boss on the LED LENS. Put the 0.5mm washer at the position shows on following picture. Note: When removing the CD position indication LED LENS take care not to damage the LED and read wires.

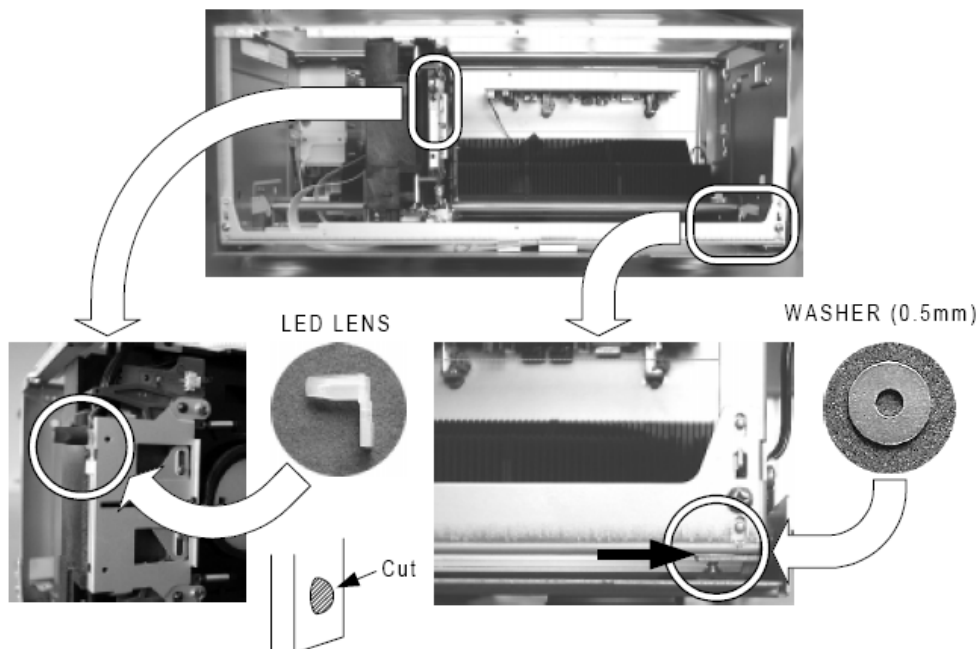

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility is will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.