

| | | | |
|--|--|---|-------------------|
| marantz® SERVICE BULLETIN | | Date: 10-Dec.-2004 | Model: CD5400 |
| | | Page: 1 / 1 | REF.NBR: MZ04-082 |
| Level | | Application: | |
| ★ ★ ★ | | See below | |
| | | Subject: The sound jump sometimes occurs during Playback CD. | |
| | | Int.ref: | |

[PHENOMENON]


When playback CD, the sound jump sometimes occurs.

[REASONS]

C156 Capacitor connected to the CLOCK line of DSP changed the signal, and microprocessor cannot recognize correct data.

[SOLUTION]

POS.NO C156 (Ceramic Capacitor 47pF) is removed.

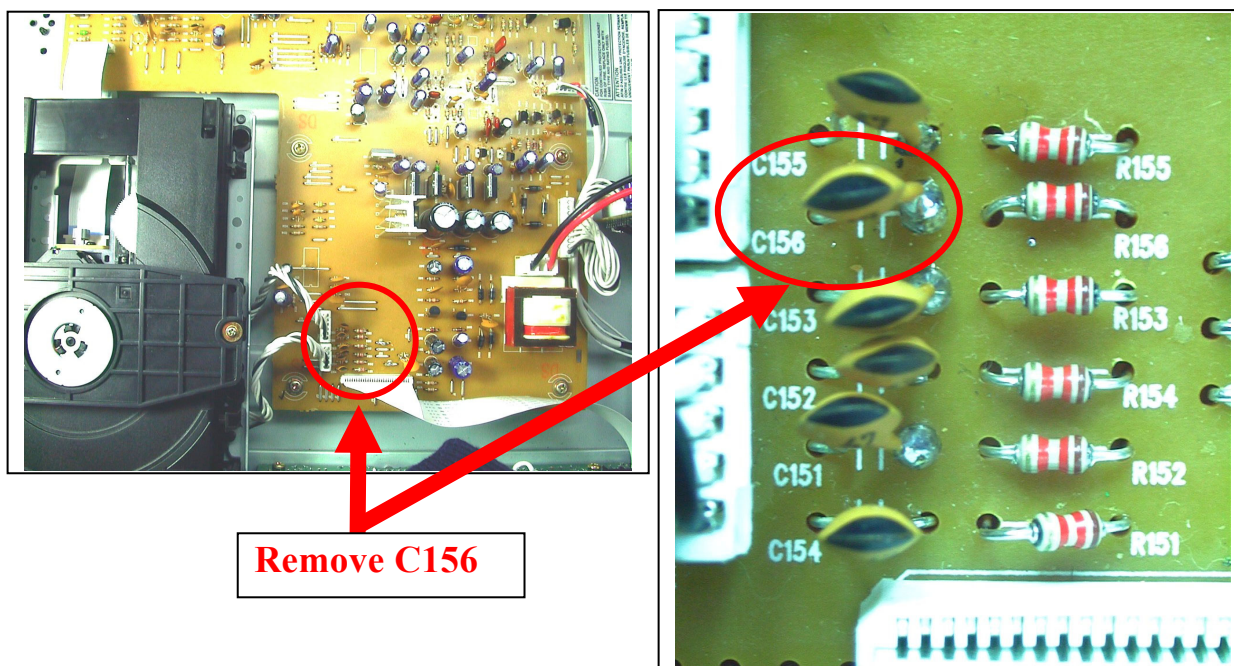

[REMARKS]

1. This problem apply to the following week code.
CD5400 apply to MZxx0448xxxxxx
2. This improvement has been done in the production week code MZxx0449xxxxxx and after.

Approved by **N.Sesnui** Written by **S.NAGAO**