



**Service Bulletin** 

No.: MZ08-052


Date: September 29, 2008

Model: MM8003

**Subject:** The supplier of the (BALANCE INPUT PWB) XLR female connectors has been changed.

**Symptom:** Due to the XLR cable (male connector) varying in quality and also due to wear, some XLR female jacks manufactured by Dongbo Industries Ltd are not tight enough to lock when the XLR connectors are inserted.

**Solution:** Replacement parts for POS NO. <u>JK50/JK51/JK60/JK61/JK70/JK71/JK80/JK81</u> (BALANCE INPUT PWB) XLR female connectors will be switched from Dongbo Industries Ltd to Jyetai Precision Industrial Co., Ltd..

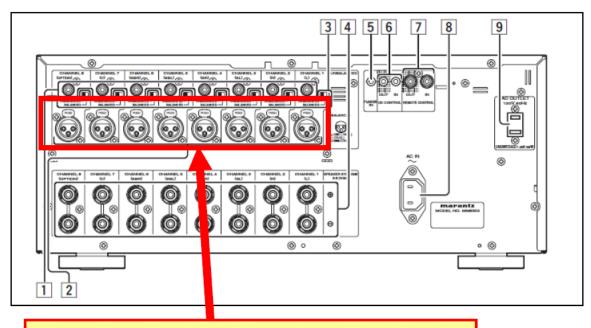


JK50/JK51/JK60/JK61/JK70/JK71/JK80/JK81

## Parts:

Old or New	POS. NO.	PART NO.	PART NAME	DESCRIPTION
Old	JK50 JK51 JK60 JK61 JK70 JK71 JK80 JK81	943646000870S	TERMINAL	XLR JACK Factory code no.CJS6S003Z. Made by Dongbo Industries Ltd.
New	JK50 JK51 JK60 JK61 JK70 JK71 JK80 JK81	00D2051254007	TERMINAL	XLR JACK  JKE TAI code no. JK-5033U*030 – made by JKETAI Precision Industrial Co., Ltd.

## **CONFIDENTIALITY NOTICE:**

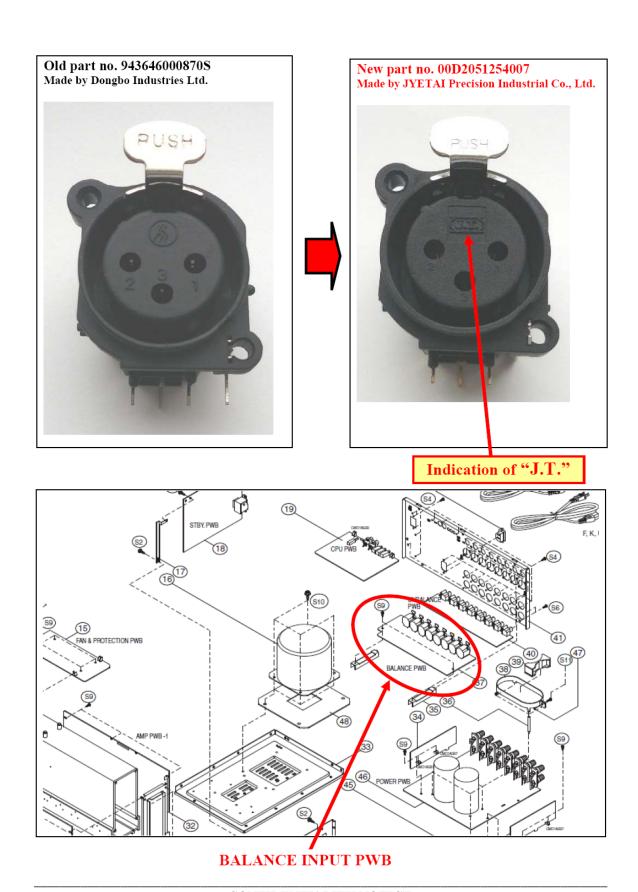

## **CONFIDENTIALITY NOTICE:**

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

## **Serial Number Range:**