



Service Bulletin

No.: MZ09-016

Date: February 23, 2009

Model: SA-15S2

Subject: Software Update Information. (Improvement of the emphasis detection program in DAC mode)


* This Service Bulletin is only service information for units with the following minor complaint. This is not call requiring the rework to be applied to stock units.

Symptom: In the DAC mode, the mute is not canceled when emphasis detection is changed to OFF from ON.

Solution: 1. The u-P software needs to be updated. The new version number after the correction is Version: **FR2009011301**. The part number for the update data is: **00M35AK499A02**

2. For the update procedure, please refer to the BD8002 Service Manual on Page 8 to 13, "5. UPDATE FIRMWARE PROCEDURE [A] Update Front CPU's software to internal Flash-ROM.".

Before the update, check the firmware version number first. See the Service Manual on Page 15, "6. SERVICE MODE".

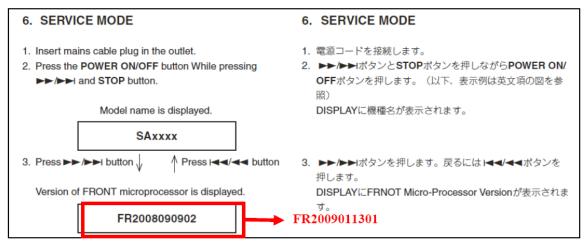

Parts:

Ref#	Description	Part Number
NA	Firmware:	00M35AK499A02
	SACD_090113.mot Ver.:	
	FR2009011301	

Serial Number Range:

Applies to 2000xxxx000100 and earlier.

This improvement has been done in production from serial number 2000xxxx000101 and later.

CONFIDENTIALITY NOTICE: