



**Service Bulletin**

**No. :** MZ07-012

**Date:** February 9, 2007

---

**Model:** SR4001

**Subject:** Software Update Information.

**Symptom:** 1. When the TV connected to the unit is powered off with the HDMI mode in "3. PREFERENCE in SETUP MAIN MENU" set to THROUGH there is no output of the input from the ANALOG INPUT within the same function.  
2. When 7.1CH INPUT is selected with HDMI assigned as the function input and VIDEO-IN in 7.1CH INPUT set to LAST, there is no video output.  
3. When the unit is outputting audio signals over the HDMI connection with the SPEAKER LEVEL selected on the MENU, there is no Test Tone output.

**Solution:** 1.The main microprocessor needs to be updated. Please check the version of the software using the information found on Page 7 of the Service Manual (Service mode); then, refer to the version history shown below.  
2. Name and part number of the update software  
File content: SR5001\_0914\_1.zip (328KB)  
Firmware : SR5001\_0914\_1.mot

REF NO	DATE	MAIN	DSP(FlashROM)
MZ07-012	2006.09.14	V0609141	DSPROM 060220

For the procedure, see Page 8 in the Service Manual.

---


**CONFIDENTIALITY NOTICE:**

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

The following serial numbers need fixed resistor values changed. Please make sure to replace the resistors when performing the update.

MZ000628000001~1300

Input PWB	
R444 / R445 / R483 / R484	8.2K → 4.7K (00MNN05472610)
R446 / R447 / R485 / R486	15K → 4.7K (00MNN05472610)

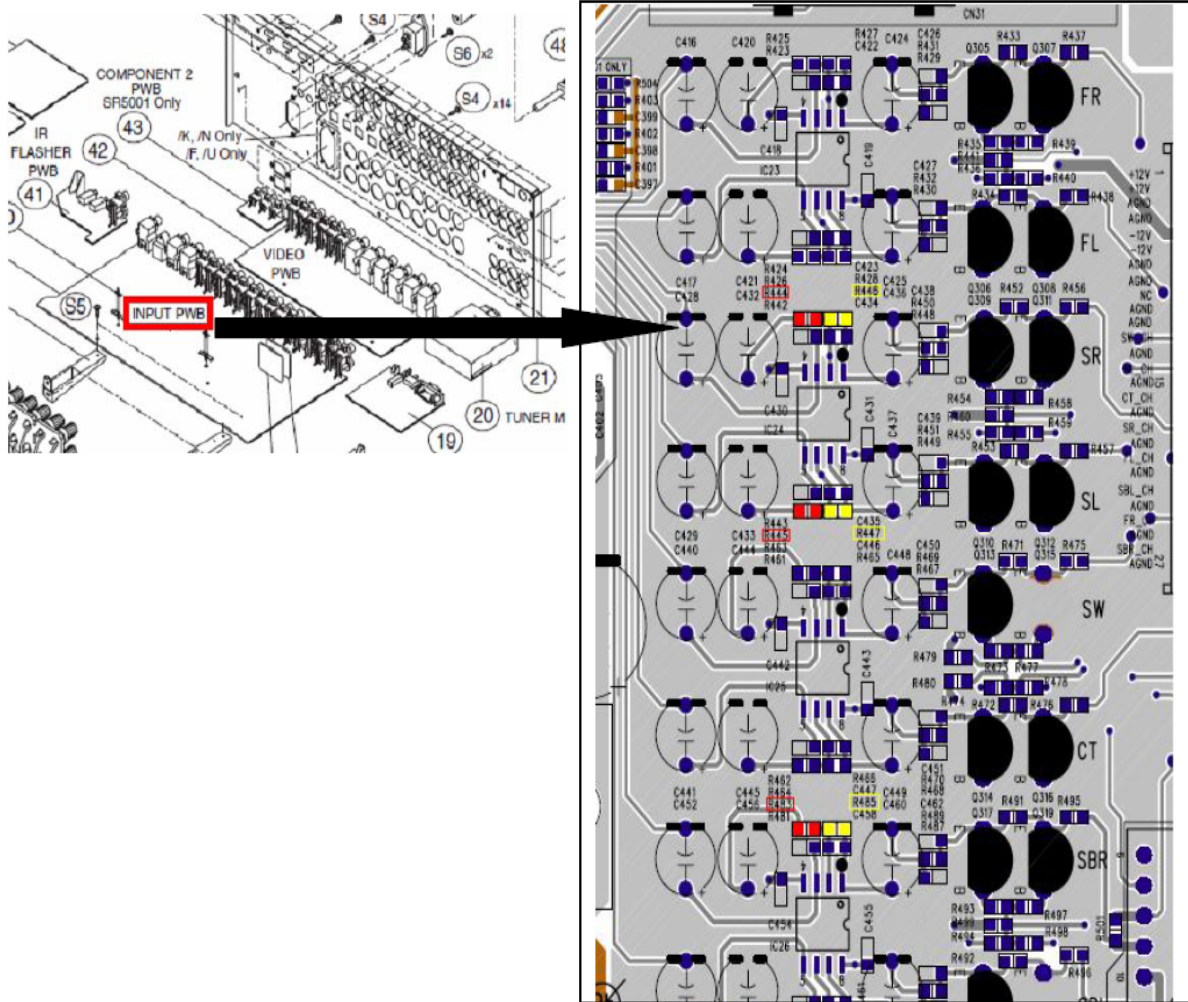

**CONFIDENTIALITY NOTICE:**

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

**Parts:**

<b>Ref#</b>	<b>Description</b>	<b>Part Number</b>
NA	DSPROM_060220, DSP (Flash ROM)	00M03CW499A02
R444 / R445 / R483 / R484 R446 / R447 / R485 / R486	4.7K ohm resistor	00MNN05472610

**Serial Number Range:**

This update is required for the following serial numbers:  
SR4001: MZ0006xx000001 ~ MZ0006xx003500.

The improvement (SR5001\_0914\_1.mot) has been already made to the following serial numbers:  
SR4001: MZ0006xx003501 ~ above.

---

**CONFIDENTIALITY NOTICE:**

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.