



SR5001

Service Bulletin


No. : MZ06-046 **Date:** April 12, 2007

Model:

Subject: Corrections made to DC trigger circuit.

Symptom: Since the electrical current capacity to the DC trigger output is low, the DC trigger output voltage may drop with some units, and as a result, such units may not operate properly even when they are connected to the output.

Solution: 1. Reverse the emitter and collector connections of Q805 on the input PWB.

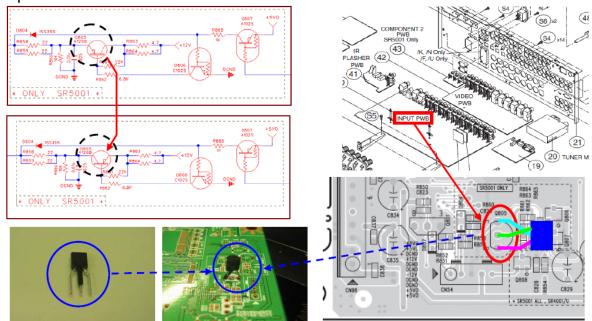

CONFIDENTIALITY NOTICE:

2. In units where problems have occurred in the trigger operation, the transistor may have been damaged. For this reason, replace Q805, and reverse the connections of its emitter and collector as above.

Parts:

Ref#	Description	Part Number
NA	KTA1268GRT, Transistor	00MHT600121A0

Serial Number Range:

^{*}Applies to MZ000637002000 and earlier.

^{*}This improvement has been done in production from serial number MZ000637002001 and later.