



Service Bulletin

No. : MZ07-013 **Date:** April 12, 2007

Model: SR5001

Subject: Software Update Information.

Symptom: 1. When the TV connected to the unit is powered off while in the HDMI mode and "3. PREFERENCE < SETUP MAIN MENU" is set to THROUGH, there is no output of the input from the ANALOG INPUT within the same function. 2. When 7.1CH INPUT is selected with HDMI assigned as the function input and VIDEO-IN in 7.1CH INPUT set to LAST, there is no video output.

- 3. When the unit is outputting audio signals over the HDMI connection with the SPEAKER LEVEL selected on the MENU, there is no Test Tone output.
- 4. When MULTI ROOM is selected in DC TRIGGER with each function turned ON and the signal input mode set to 7.1CH INPUT, the DC TRIGGER will not function.
- 5. As regards the U1B version, when the mode is switched to XM by the RS232C command [@SRC:J] with the input set to TUNER, there is no audio output.

Solution: The main microprocessor needs to be updated. Please check the version of the software using the outlined in the Service Manual on Page 7 of Service mode.

Parts:

Ref#	Firmware	File Name
	SR5001_0914_1.mot	SR5001_0914_1.zip

For the procedure, see Page 13 in the Service Manual.

CONFIDENTIALITY NOTICE:

Firmware Version History

REF NO	DATE	MAIN	DSP(FlashROM)
MZ07-013	2006.09.14	V0609141	DSPROM 060220

Serial Number Range:

This update is required for the following serial numbers: Up to ~ MZ000643004000*

^{*}The update has already been applied from MZ000643004001~5500.