



Service Bulletin

No.: MZ09-100

Date: September 30, 2009

Model: SR6004, SR5004


Subject: A Hum Noise occurs at shorting of FRONT AUX Audio input.

Symptom: The AUX Audio input (Front) terminal is shorted at MAIN Volume MAX. The Hum noise is louder than REAR AUX input terminal in the rear panel. The earth side of the AUX input terminal is connected directly with the chassis, the earth circuit is looped.

Solution: Add a capacitor and cut the trace as outlined.

COUNTERMEASURE:


Please add the following capacitor on AUX P.W.B. (FRONT P.W.B. ASSY: CUP12205Z/Y) and cut the pattern as shown below.

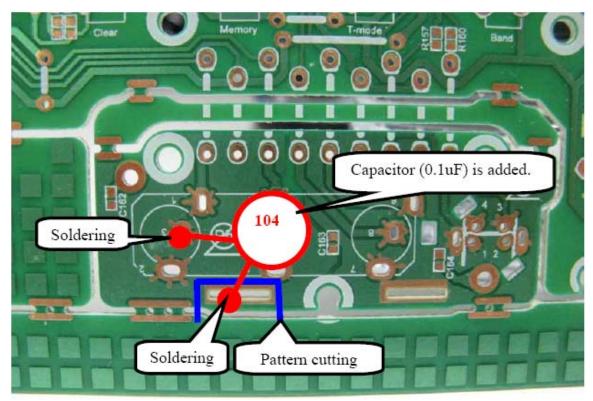

Bottom SIDE of CUP12205Z/Y AUX P.W.B. (FRONT P.W.B. ASSY)

Before the modification:

Ref. Nr.	Parts Number	Parts Name	Remarks
1	nsp		0.1uF+80/-20% /50V CERAMIC Capacitor CCBS1H104ZFT

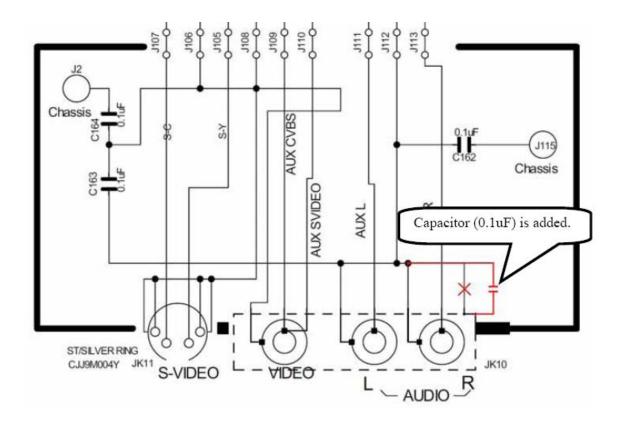

Serial Number Range:

Please apply the above modification to production models in the following serial number range.

SR6004 ~ MZ0009**001640 SR5004 ~ MZ0109**004210