



D&M Holdings Inc.

100 Corporate Drive Mahwah, NJ 07430

marantz[®]

Service Bulletin

No. : MZ09-045

Date: September 15, 2009

Model: SR6003

Subject: When a specific TV (SHARP[®] LC-**A33T or LC-**GX3T) and the SR6003 A/V amplifier are connected via HDMI the picture may not be reproduced correctly.

* This Service Bulletin is only for service information outlining the following minor improvement. This is not call requiring a rework and does not need to be applied to stock units.

Symptom: When the customer turns on the A/V amplifier or TV and the customer selects input function of the TV or if the customer selects the HDMI 1/2 input, the picture of TV might not be able to be reproduced correctly.

Solution: 1. Improvement of the printing board. Please modify the HDMI PWB as outlined in the attached instruction manual.

Sub printing board: **943639008870M** (SR6003 Service PWB for Sharp TV).

2. Improvement of the firmware. The HDMI CPU SOFTWARE will be updated. The new version number after the correction will be [[HDMI MCU h28](#)]. The update software to be used is [00M07DW499B3.zip](#).

The write data file name: "[HDMI_REPV5_090826_h28.mot](#)"

For the procedure, please refer to the service manual.

Serial Number Range:

Please apply the above modification when customer has claim.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.