



Service Bulletin

No. : MZ02-027

Date: December 4, 2006

Model: SR5200, SR6200, SR7200

Subject: Video synchronization problem.

Symptom: When the screen changes from a dark scene to light scene a video synchronization problem is noticed.

Solution: 1. Electrolytic capacitor C846 (1uF/50V) is changed to 0.33uF/50V on the S-VIDEO CIRCUIT BOARD. For part location - See Page 37 of the Service manual for SR5200/SR6200. See Page 35 of the Service manual for SR7200.
2. Electrolytic capacitor C846M (1uF/50V) is changed to 0.33uF/50V on the VIDEO CIRCUIT BOARD. For part location - See Page 38 of the Service manual for SR5200/SR6200. See Page 36 of the Service manual for SR7200.

Parts:

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
C846	1uF/50V	NA	0.33uF/50V	0.33uF/50V
C846M	1uF/50V	NA	0.33uF/50V	0.33uF/50V

Serial Number Range:

1) This countermeasure applies to this claim only. 2) This improvement has been done in production after serial number MZ030202000001 and later. (SR5200 /U1B) serial number MZ030202000001 and later. (SR6200 /U1B) serial number MZ030202000001 and later. (SR7200/U1B)

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility is will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.