



**Service Bulletin** 

No.: MZ09-008

Date: February 18, 2009

Model: SR7002, SR8002

**Subject:** Software Update Information

**Symptom:** 1. The HDCD indicator will not light up when the unit is switched from the function of playing HD-Audio (eg. DTS-Master Audio) via HDMI to that of playing HDCD input via SPDIF.

- 2. On SR7002N and SR8002N, the "#" character used for RDS will turn into "II".
- 3. When the HDMI connector is slowly inserted with the projector made by Epson etc., HDMI might not be linked.

**Solution:** The MAIN CPU and HDMI CPU software must be updated. First, please check the version of the current firmware in reference to SERVICE MODE of the Service Manual. After performing the update, check the indicated firmware version. For information on how to rewrite the firmware, open the Service Manual and refer to "7. UPDATE FIRMWARE".

Firmware version History

I II III Wate v	Thinware version instory				
Service Code	REF.NBR.	MAIN CPU	HDMI CPU	DSP CODE	
MZ08	MZ09-008	V090121 1	h39	B1 10805081	
				B2 20803131	
MZ07	MZ08-038	V080603 1	h38	B1 10805081	
				B2 20803131	
MZ06	MZ08-023	V080313 1	h35	B1 10708201	
				B2 20708231	
MZ05	-	V080307 1	h34	B1 10708201	
				B2 20708231	

Latest

Please check the version of the firmware and, if any of the above is found yet to be updated, make sure to perform the latest update.

## Update software and Part no.

- 1) Firmware Main: sr8002Main090121\_1.mot Parts No: 00M36CW499A08 (For how to rewrite, see the Service Manual on Page 21.)
- 2) Firmware HDMI: HDMI\_REPV3x090122h39.mot Parts No: 00M36CW499B06 (For how to rewrite, see the Service Manual on Page 31.)

## **Serial Number Range:**

This problem applies to the following serial number.

1) SR7002, SR8002 applies to MZ07xxxxxxxxx (Service code 07 and earlier). This improvement has been done in production from serial number MZ08xxxxxxxxx (Service code 08 and after).