



Service Bulletin


No. : MZ03-003 **Date:** December 5, 2006

Model: SR7300

Subject: Broken Knob

Symptom: Broken Volume or Selector knob by transportation. The clearance between the front panel and knob is a little large and this can stress to the volume or selector shaft.

Solution: Add the spacer (see parts) to the front panel as follows:

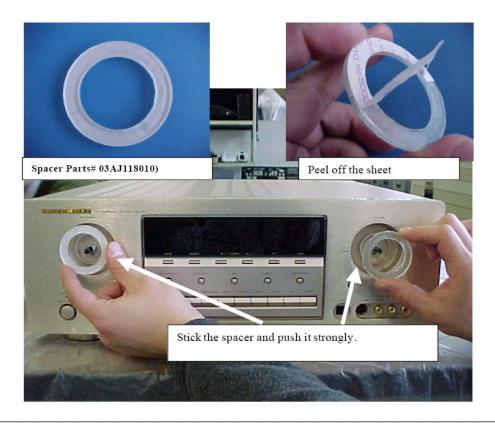

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility is will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Parts:

Ref#	Description	Part Number
NA	SPACER	03AJ118010

Serial Number Range:

This improvement has been done in production after LOT number "14" and later (The LOT number is "##" of serial number "MZxxxxx##xxxx".)

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility is will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.