

marantz® SERVICE BULLETIN		Date: 14-Feb-2003	Model: SR7300
		Page: 1/1	REF.NBR: MZ03-004
Circulation:		Application:	
x for information customer complaint in case of service mandatory		See below	
		Subject: Problem with SRS dialog function doesn't work.	
		Int.ref:	

[PHENOMENON]

The SRS dialog function doesn't work after the level adjustment of SETUP MENU.

[CAUSE]

A problem in the microprocessor software.

[SOLUTION]

UPDATE firmware for CPU and DSP.

Firmware for CPU: V021128_1(The files to be used are “**H8Download.exe**” and “**sr730011281.mot**”)

Firmware for DSP: V1105 (The file to be used is “**UpgradeDSP.exe**”)

Refer to the SR7300 service manual page 53 and page54 for How to UPDATE FIRMWARE.

[NECESSARY PART]

Update of the CPU and DSP DISC.....Parts no. *SR7300CDR

[REMARKS]

The countermeasure apply to this claim only.

This solution has already been applied in the production line after the week code number “**MZ000245xxxxxx**” and later or the Lot number “**MZxxxxxx09xxxx**” and later.

The week code number and service modification code are printed in the serial number label on the rear panel. (ex.**MZxx0245xxxxxx**)