



Service Bulletin

No. : MZ05-007

Date: January 9, 2007

Model: SR7500 / SR8500

Subject: Additional specification information

Symptom: During playback of a Dolby Digital Disc if Dialog Normalization changes, it is not displayed on the FL Display. The contents of the firmware update will display the amount of Dialog Normalization change on the FL Display.

Solution: The firmware has been improved.
Update the Microprocessor (IC36) firmware to Version V041209 1.
Please refer to the service manual page 12 "6. UPDATE FIRMWARE" for more details.










Attention: Copy the SR8500_CPU_V041209_1.zip file to your hard drive and unzip it before using.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

File name for Update Disc of 90M-SR8500CDR

SR8500 CPU V041209 1.zip

名前	サイズ
 H8Download.exe	200 KB
 H8Download.GID	9 KB
 H8Download.hlp	11 KB
 h82398_19200.inf	1 KB
 h82398_38400.inf	1 KB
 SR8500_0412091.mot	814 KB
 upmicro.ini	1 KB
 wc192.wrt	7 KB
 wc384.wrt	7 KB

This is used ←

This is used ←

4. SERVICE MODE

Microprocessor (IC36), DSP(IC20)Version and FLD Segment Check Mode.

- While the power is on, PURE DIRECT, MRAC and 7.1CH INPUT buttons simultaneously more than 8 seconds. The FL display shows "SERVICE MODE" for 2 seconds then shows the model name.

S	E	R	V	I	C	E	M	O	D	E
			S	R	8	5	0	0		

- Press ENTER button, The software version of the microprocessor (IC36) is displayed in the format below.

V	0	4	0	8	0	5	1		
	Year	Month	Date				Dest.		
								(Dest. : Destination)	

- Press ENTER button again, The software Serial Number that is written in the factory is displayed.

M	Z	X	X	X	X	X	X	X	X	X	X
---	---	---	---	---	---	---	---	---	---	---	---

- Press ENTER button again, The software Type Number is displayed.

S	O	F	T	T	Y	P	E			X	X
(XX is displayed in Hex)											

→ V 0 4 1 2 0 9 1

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Parts:

Ref#	Description	Part Number
NA	Firmware update	SR8500_CPU_V041209_1.zip

Serial Number Range:

This problem applies to the following week code.

SR7500 / SR8500 applies to MZ000503xxxxxx and earlier.

This improvement has been done in production beginning with week code MZ000504xxxxxx and later.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.