



Service Bulletin

No.: MZ04-034 **Date:** March 12, 2007

Model: SR8200, SR9200

Subject: After specific operation (outlined below), SETUP sometimes returns to initial setting.


Symptom: 1. Enter SETUP MENU, Set the Speaker level of SURROUND to "+1dB or more". Then, exit from MENU.

- 2. The Sound level is set to "negative infinity" from "other than negative infinity" by VOL Knob
- 3. Press the POWER switch to turn off and turn on.
- 4. "Clear memory" is displayed and SETUP sometimes returns to initial setting.

Solution: 1) Update the CPU's software version to V0404051.

2) Update the DSP's software. Please refer to the service manual on pages 97 to 98 for details of "9.UPDATE FIRMWARE".

Before updating check the CPU (QU01) version. It can be confirmed in the Service Manual on page 95 "SERVICE PROGRAM".

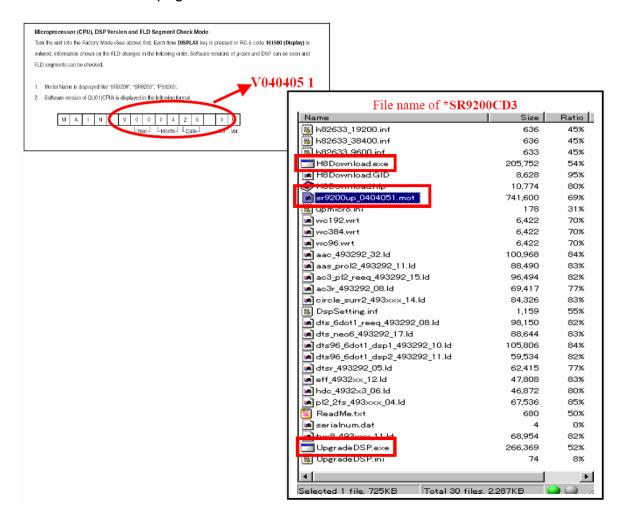

The countermeasure applies to this claim only. After updating the unit, the following surround mode will be changed. (Caused by new DSP firmware)

- * SR9200
- 1. THX Ultra mode => THX Ultra2 mode
- 2. SRS CS => SRS CS II
- * SR8200
- 1. SRS CS => SRS CS II

Please inform your customer about these changes.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Parts:

Ref#	Description	Part Number
NA	Update Firmware,	*SR9200CD3
	CPU:	
	SR9200UPG_CPU_V0404051	
	DSP:	
	SR9200UPG_DSP_030124	