

<b>marantz®</b> <b>SERVICE BULLETIN</b>		Date: 18-June-2002	Model: ST6000
		Page: 1 of 1	REF.NBR: MZ02-006
Circulation:		Application:	
x for information customer complaint in case of service mandatory .....		ALL	
		Subject: The problem that FM stereophonic broadcasting is received by the mono.	
		Int.ref:	

**[PHENOMENON]**

A receiving channel carries out a drift then FM stereophonic broadcasting is received by the mono.

**[CAUSE]**

The adjustment was insufficient.

**[SOLUTION]**

**T101** on the main circuit board is adjusted to **0mV + - 10mV**.

Refer to the ST6000 service manual page 21 for FM MONO DISTORTION ADJUSTMANT.

Service manual part no. is 282W855010(3120 785 22160).

**[REMARKS]**

The countermeasure apply to this claim only.

This improvement has been done in the production line after  
the serial no.MZ010225005371 and later.(ST6000/N2B)  
the serial no.MZ010223007181 and later.(ST6000/N2G)  
the serial no.MZ010223005862 and later.(ST6000/U2B)

Approved by **M.KIMURA**

Written by **S.NAGAO**