

marantz[®]

Service Bulletin

No. : MZ10-004

Date: April 13, 2010

Model: UD9004

Subject: Modification of size of screw.

Countermeasure is applicable upon every repair (within S/N range) and upon customer complaint.

Symptom: When customers insert a disc the label side of the disc might be damaged because the screws stick out "0.4~0.7mm" from the Mechanism base.

Solution: Countermeasure: We exchanged the "2x4mm" to a "2x3mm" (2 pcs.) screw. Fixing torque: 2.0Kgf +0.2 / -0.
Before modification: 2x4mm CBS-B (Color is black)
After modification: 2x3mm CBS-Z (Color is silver)



CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Parts:

Ref#	Description	Part Number
NA	2x3 CBS-Z	ORD4713801039

Serial Number Range:

Please apply the above modification to the models in the following serial numbers. (Full-digits)

*****000001 ~ *****000170

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.