
SERVICE HINT

PROBLEM:

No audio output on switching on.

CAUSE:

The AC mains voltage is too high, causing a voltage regulator to lock up.

This can occur when the AC mains is more than 234V (European version)

SOLUTION:

Replace U7, Motorola MC7912CT by NEC7912.

PRODUCTION:

A special thanks to NAD Service Department Aylesbury, UK.