

---

---

## SERVICE HINT

---

---

### ***PROBLEM:***

A buzz is audible in the centre and rear channel.

---

### ***CAUSE:***

Not proper grounding of the amplifier.

---

### ***SOLUTION:***

Cut the shielding of cable to center / rear amplifier (P621) on the volume control PCB side (P621a). Solder on this side a cable directly to the PCB and solder the other end to the grounding of P621b.

---

### ***PRODUCTION:***