

## **SERVICE HINT**

---

---

### ***PROBLEM:***

Disc stops playing, or player won't accept a CD. Fault could be intermitted.

---

### ***CAUSE:***

Bad solderjoint of the focus transistors, 2SB1237R/2SD1858R or 2SB909/2SD1225.

---

### ***SOLUTION:***

Re-solder the joints.

In case of a defect of one (or both) transistors, you can also replace them by 2SB649/2SD669 . The advantage of these replacement transistors is a better cooling, please do not mount them directly to the PCB, but keep some distance.

---