
MODIFICATION

PROBLEM:

A pop is audible whilst switching the unit off.

SOLUTION:

Replace the resistors R257 and R258 from 82 ohms to 330 ohms

It is advisable to replace the resistors when the unit comes in for any service.

PRODUCTION:

These modifications will be implemented in the production starting with serial number G6Y71002253.