
SERVICE HINT

PROBLEM:

A hiss is audible in the centre channel.

CAUSE:

The used op-amp HA17458 (Q405) can be somewhat noisy.

SOLUTION:

Replace the IC Q405 by a NJM2043DD.

PRODUCTION: