
SERVICE HINT

PROBLEM:

A buzz is audible in the centre and rear channel.

CAUSE:

Not proper grounding of the amplifier.

SOLUTION:

Cut the shielding of cable to center / rear amplifier (P621) on the volume control PCB side (P621a). Solder on this side a cable directly to the PCB and solder the other end to the grounding of P621b.

PRODUCTION: