
MODIFICATION

PROBLEM:

You may receive the complaint that the Left and Right channel are not switched on at the same time. This is only noticeable if you switch on the unit with signal already applied to it.

CAUSE:

The muting circuit in the pre-amplifier may not release both channels at exactly the same time.

SOLUTION:

- Change D309 and D310 from 1N4148 to 10M Ohm 1/6W 5% Metal Film Resistor

It's advisable to perform this modification whenever a unit comes in for service.

PRODUCTION:

This modification is implemented in production from Serial no. H08C35005910