

Circuit Change

PROBLEM: Resistor is overheating.

CAUSE: Resistor R227 is underrated.

SOLUTION: Change R227 from 560R 1/2W fusible resistor to a 560R 2W fusible resistor.

PRODUCTION:

This change has been implemented in production from serial number:H1XC35015764

Contact:

NAD Electronics International
633 Granite Court
Pickering, ON Canada L1K 3K1
Voice: 905-831-0799 FAX 905-837-6357
www.NADelectronics.com